

REMONUMENTATION

FEB 22 1996
COMMISSION

Approved By Delta County
Land Survey Remonumentation
Peer Group Under Act 345 Of
P.A. Of 1990 On 1/17, 1996

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Robert E. Schuchling
Acting Chairman

For corners in
DELTA
(County)

Located In: Corner Code #

1. Public Land Survey T 39 N R 24 W I-9 I-10
T _____ R _____
T _____ R _____
T _____ R _____

2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims I-9 [NW COR S.26] I-10 [W1/4 COR S.26]

Revised Jan 18 1996
at 9:00 o'clock AM in Liber 8 Page 123
William C. Thorne
Reg. of Deeds.
Delta County, Michigan

Register of Deeds Stamp & File Number


	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, M.P. DAVIS, in a field survey on JUNE, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
I-9 [NW COR S.26] GEORGE ADAIR, D.S. - 1852 - WOOD POST (SUGAR 20°-N25°E-16 LINKS) (SUGAR 12°-S52°W-23 LINKS) M.S. McNABB - 1919 - IDENTIFIED BY JCT OF FENCE LINES N-S & E-W (MAPLE 14°-N65°W-22.5')
I-10 [W1/4 COR S.26] GEORGE ADAIR, D.S. - 1852 - WOOD POST (LYNN 16°-N50°E-34 LINKS) (SUGAR 12°-S56°W-45 LINKS) M.S. McNABB - 1919 - ESTABLISHED 1/2 DISTANCE BETWEEN CORNERS & SET IRON BOLT - NO NEW WIT'S NOTED

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
I-9 [NW COR S.26] NO EVIDENCE OF JCT OF FENCE LINES FOUND IN PLACE IN 1919 BY McNABB. CORNER POSITION IS NOW OCCUPIED BY A LARGE CULTIVATED FARM FIELD. RESTORED CORNER POSITION BY DISTANCE-DISTANCE INTERSECTION UTILIZING McNABB'S RECORD DISTANCES NORTH FROM THE SW CORNER OF SEC 26 & WEST FROM THE N1/4 COR OF SEC 26. ACCEPTED THIS LOCATION AS BEING THE BEST AVAILABLE EVIDENCE AS TO THE POSITION OF THE ORIGINAL CORNER.

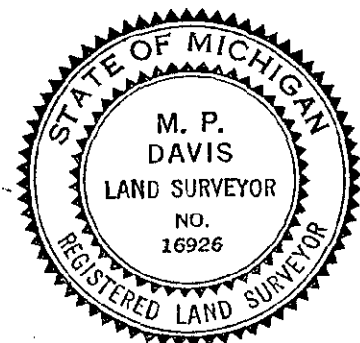

I-10 [W1/4 COR S.26] NO EVIDENCE OF McNABB'S 1919 IRON BOLT AS LOCATION OF CORNER IS IN AN OPEN HAY FIELD. RESTORED CORNER POSITION AT MIDPOINT BETWEEN SEC CORNERS N & S PER McNABB'S 1919 SURVEY.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-9 BURIED 16" BELOW SURFACE A BERNTSEN ALUMN MONUMENT WITH THE CAP STAMPED TO ID THE CORNER POSITION.
SURVEY MONUMENT SIGN POST NORTH 50.45' (TO FACE) NOTE: CORNER POSITION IS LOCATED IN AN OPEN CULTIVATED FARM FIELD. THERE ARE NOT WIT'S AVAILABLE WITHIN A USABLE DISTANCE.

I-10 SET, 15" BELOW SURFACE, A 5/8" X 18" REBAR W/A 3-1/4" ALUMN CAP STAMPED TO ID THE CORNER POSITION.
TAMARACK 5" N38°W 159.07' ELM 9" S14°E 149.66' SURVEY MONUMENT SIGN POST NORTH 121.52' (TO FACE) NOTE: CORNER POSITION IS LOCATED IN AN OPEN FARM FIELD. THERE ARE NO OTHER WIT'S WITHIN A USABLE DISTANCE.

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC & DISTANCES ARE TO A NAIL W/A REFERENCE TAG IN THE OBJECT, UNLESS OTHERWISE NOTED.

Signed by M.P. Davis Date JAN 8, 1996

Surveyor's Michigan License No. 16926