

**SURVEY & REMONUMENTATION**

**JAN 14 1998**

Approved By Delta County  
Land Survey Remonumentation  
Peer Group Under Act 345 Of  
P.A. Of 1990 On 12/18, 1992  
*Phyllis Schmeling*  
Acting Chairman

**SECTION**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
DELTA  
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 41 N R 22 W C-01 & C-03  
T 42 N R 22 W C-13  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
- 2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

*Dec 19 1997*  
*9:00 AM*  
*8 279*  
*Walter E. ...*

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims C-01 [NW SEC 5 - C-13 SAME CORNER] C-03 [NW SEC 8]

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, M.P. DAVIS, in a field survey on OCTOBER 01, 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law: established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**


C-01 [NW COR SEC 5] JOHN HURT, DS - 1845 - WOOD POST - (BLACK ASH 10"-N76°W-25 LINKS)(BLACK ASH 07"-N05°E-07 LINKS)  
A.MERRYWEATHER, DS - 1847 - POST IN PLACE (CEDAR 09"-S60°W-31 LINKS)(CEDAR 10"-S40°E-18 LINKS)  
M.S.McNABB-1919-ID COR FROM ORIG. B ASH NE PLAIN-SET NEW STAKE & BT STAKES NE & SW 33'  
M.S.McNABB-1932-ID FROM PREVIOUS SURVEY BT STAKES IN PLACE

C-03 [NW COR SEC 8] A.MERRYWEATHER, DS - 1847 - WOOD POST - (BIRCH 18"-N42°W-16 LINKS)(BIRCH 18"-S20°E-32 LINKS)  
M.S.McNABB-1922-DROVE I.P. WITH BROKEN BRICK AROUND IT. ESTABLISHED ON HILL, FIELD DISTANCE 4 WAYS FROM SWAMPS THAT CHECK & 235' EAST OF RAILROAD CENTER LINE (BIRCH 14"-S40°W-21')(SOFT MAPLE 4"-N86°W-37.6')

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

C-01 [NW COR SEC 5] NO CORNER EVIDENCE FOUND, REESTABLISHED CORNER POSITION AT McNABB'S RECORD DISTANCE EAST OF THE N1/4 COR OF SEC 6 & UTILIZING McNABB'S HORIZONTAL ANGLE AS MEASURED EAST FROM THE N-S 1/4 LINE OF SEC 6. ACCEPTED THIS LOCATION AS BEING THE BEST AVAILABLE EVIDENCE AS TO THE POSITION OF THE ORIGINAL CORNER.

C-03 [NW COR SEC 8] FOUND IN PLACE 1 1/2" IRON PIPE & BROKEN BRICK AROUND IT. ID CORNER POSITION FROM McNABB'S MAPLE BT NW (STILL GREEN & BLAZE OVERGROWTH PLAIN) ACCEPTED EXISTING MONUMENT AS BEING A CAREFUL & FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.

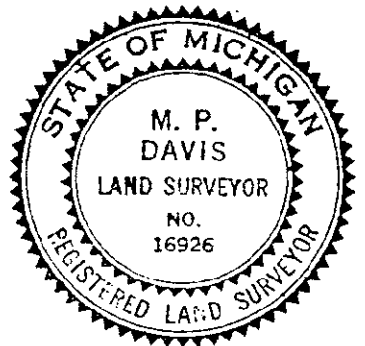

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

C-01 SET A BERNTSEN ALNB30 ALUM MONUMENT WITH THE CAP STAMPED TO ID THE CORNER POSITION.  
CEDAR 05" CEDAR 05" SPRUCE 07" BALSAM 07" SURVEY MONUMENT SIGN POST  
N51°W N55°E S56°E S32°W SOUTH  
28.41' 44.29' 44.00' 22.85' 3.00' (TO FACE)

C-03 REPLACED EXISTING MONUMENT W/A BERNTSEN ALNB30 ALUM MONUMENT WITH THE CAP STAMPED TO ID THE CORNER POSITION.  
MAPLE 12" (OLD BT) IRONWOOD 06" IRONWOOD 09" SURVEY MONUMENT SIGN POST  
N76°W N18°E S23°W S57°E  
37.16' 7.50' 10.88' 3.00' (TO FACE)

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC & DISTANCES ARE TO A NAIL W/A REFERENCE TAG UNLESS OTHERWISE NOTED.

Signed by M.P. Davis Date 11/21/97  
Surveyor's Michigan License No. 16926