DEC 1 8 1995

## COMMISSION


## LAND CORNER RECORDATION CERTIFICATE

RECORDED

For corners	: in	Fi	ing Require	ment of Act 74, Mich. P	P.A. 1970 1335 NOV 21 ANTI: 27
Dickins		Located	n:	Corner Code #	
1. Public l	_and Survey	T T	ON R 29W R R R R	C-11 D-11	REMOVE REPOS
2. Propert	y Controlling				
3. Miscella	•	s T	R R		Register of Deeds Stamp & File Number
		Recorded Plat			A B C D E F G H 1 J K L

I, Robert F. Perkins, in a field survey on <u>Oct. 12</u>,19<u>95</u> do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

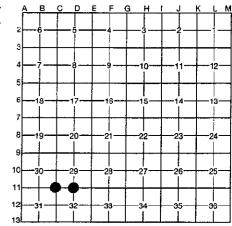

A. Description of original monument and accessories and/or subsequent restoration:

C-11 Northeast Corner, Section 31 Post J. Mullett, D.S. 1849 Original Bearing Trees Sugar 10" S60°E (M.B.) 8 Lks. Sugar 8" N65°W (M.B.) 16 Lks.

D-11 North One-Quarter Corner, Section 32 Post J. Mullett, D.S. 1849 Original Bearing Trees Hemlock 15" N12°W 17 Lks. S82°E Hemlock 15" 26 Lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-11 No Evidence of Original Corner or Accessories Found. City of Norway Land Record (Sh. 5) indicates Concrete Monument buried 1' in Road. R. Perkins found and witnessed Corner in 1969-Found 1969 Witnesses.

Corner Researched in 1994.

D-11 No Evidence of Original Corner or Accessories Found. 1972 - R. Perkins found 1" Iron Pipe buried in Road L. and N-S Fences. Witnessed and Recorded Corner in 1969 Corner Researched in 1994.

> ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON

1-20-95 COP COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-11 Found Concrete Monument buried 8" at above Location. Set Monument Box over found Monument. New Witnesses Set 3" Stamped D.C.Remon. W.C., N24°E (M.B.) 33.30' W/Carsonite Stake 7" Cedar Post N67°E (M.B.) 61.86' P. Pole #71-2462 S36°E (M.B.) 51.81' X Cut on 1' Boulder S69°W (M.B.) 46.96'

D-11 Above Corner Lost due to Road Construction. Set 21" Stamped D.C.Remon. Corner at above Location from 1972 B.T.'s. New Witnesses Maple 7" N53°W (M.B.) 116.84' (Old BT) Maple 8" S33°E (M.B.) 69.73' (Old BT) P.Pole (No #) N72°E (M.B.) 42.33 X Cut on 2' Boulder S72°W (M.B.) 79.55 Carsonite Stake S08°W (Markumana) . 20'

Signed by_	1 Coant )	Perkers,
·		

Surveyor's Michigan License No. 12027

Date Nov. 7, 1995

FORM APPROVED BY MICHIGAN STATE BOARD OF

