

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
 (County)

Located In:

Corner Code #

- | | | |
|------------------------------------|--------------------------------------|-------|
| 1. Public Land Survey | T <u>40N</u> R <u>29W</u> | J1 |
| | T ___ R ___ | _____ |
| | T ___ R ___ | _____ |
| | T ___ R ___ | _____ |
| 2. Property Controlling in Section | S <u>2</u> T <u>40N</u> R <u>29W</u> | 1 |
| | S ___ T ___ R ___ | _____ |
| 3. Miscellaneous Property in Sec. | S ___ T ___ R ___ | _____ |
| | S ___ T ___ R ___ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Feb 15 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


- (J1) North Quarter corner of Section 2. Corner not established in the original survey. Found no subsequent record.
 (1-Sec.2) West 1/16 corner on the north line of Section 2. Corner not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (J1) Established the corner on the 4th Correction line, a line of mean true bearing between adjacent monumented standard corners B13 and C13 of T41N-R28W, and equidistant between the closing corner monuments at I1 and at K1, 2637.76' west and east.
 (1-Sec. 2) Established the corner on the 4th Correction Line, a line of mean true bearing between monumented adjacent standard corners A13 and B13 of T41N-R28W, and equidistant between monumented J1 1318.72' east and the closing corner on the Correction Line for I1, 1318.72' west. From the corner thus established, I found a 1" iron pin, not of record, S02E, 26 feet distant.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|---|--|
| (J1) Set 1" ID iron pipe with 4" aluminum MDNR cap. Blazed and scribed: | (1) Set 1" ID iron pipe with 4" aluminum MDNR cap. Blazed and scribed: |
| 11" Y. Birch N50E 20.4' "1/4S BT" | 5" Ash S42W 26.2' "1/16S BT" |
| 8" Sugar S36E 11.9' do | 6" Ash N25E 65.6' do |
| 12" Y. Birch S17W 4.3' do | 12" dbl Spruce N71E 77.2' "1/4S NBT" |
| 12" Y. Birch N79W 14.0' do | 9" Spruce S47E 39.1' do |
- Bearings are magnetic. Distances to notch in lower blaze.
 An MDNR monument at B13 T41N-R28W bears S87E, 16.52' distant. Bearings are magnetic. Distances to notch in lower blaze.

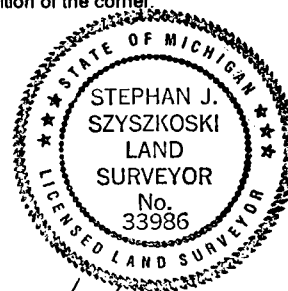

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 1/16/01

For the Michigan Department of Natural Resources - Forest Management Division