

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
 (County)

Located In: Corner Code #

- | | | | |
|------------------------------------|---|---|--------------|
| 1. Public Land Survey | T | R | _____ |
| | T | R | _____ |
| | T | R | _____ |
| | T | R | _____ |
| 2. Property Controlling in Section | S | T | 40N R 29W 9 |
| | S | T | 40N R 29W 13 |
| 3. Miscellaneous Property in Sec. | S | T | R |
| | S | T | R |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

13 May 02 2001
 9 Apr 30 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (9-Sec. 3) East 1/16 corner of Section 3. Not established in the original survey. Found no subsequent record.
 (13-Sec. 3) Southeast 1/16 corner, Section 3. Not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (9-Sec. 3) Established the corner midway and on a straight line between Quarter corner 1325.88' East and Center of Section (intersection of 1/4 lines) 1325.88' West.
 (13-Sec. 3) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (9) Set 1"IDx32" I.pipe with 4" aluminum MDNR tablet. Blazed and scribed:
 5" Maple S82W 11.6' 1/16S BT"
 4" Maple N33E 18.6' do
 8" Maple N58E 37.0' do
 7" triple Maple S50E 21.6' do
 Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
 (13) Set 1"IDx32" I.pipe with 4" aluminum MDNR tablet in 3ftx3ftx2.5ft tall rock mound. Blazed and scribed:
 6" Sugar N22E 16.6' 1/16S BT"
 5" W.Ash S14E 8.0' do
 8" Sugar N88W 11.4' do
 4" W.Ash N18W 31.1' do
 Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

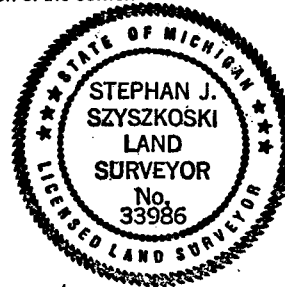

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/3/01

For the Michigan Department of Natural Resources - Forest Management Division