

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Dickinson</u>	Located In:	Corner Code #
(County)		
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>3</u> T <u>40N</u> R <u>29W</u>	<u>12</u>
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Apr 30 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19___ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3								●					
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration:
 (12-Sec. 3) South 1/16 corner, Section 3. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(12-Sec. 3) Established the corner midway and on a straight line between Quarter corner 1342.83' south and Center of Section (intersection of quarter lines) 1342.83' north. From the position thus established, I found the following: 1) a 1.25" ID iron pipe projecting 2.6', not of record, N69W 38.4' distant; 2) a 5/8" ID iron pipe projecting 1.9', not of record, with blue paint line to west, N83W 143.2' distant.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(12) Set 1" IDx32" I. pipe with 4" alum.
 MDMR tablet. Blazed and scribed:
 8" Y. Birch N34E 11.1' "1/16S 8T"
 15" Cedar S08E 3.8' do
 9" Sugar S57W 21.1' do
 5" Sugar N20W 12.9' do
 Set sq'd cedar post adjacent. Bearings
 are magnetic. Distances to notch in
 lower blaze.

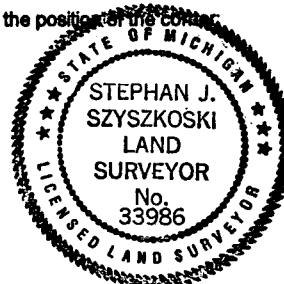

Signed by Stephan J. Szyszkoski Date 5/3/01
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division