

MAR 03 1998

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1997 DEC 10 PM 3:54

For corners in Dickinson (County)

Located In: Breitung Twp.

Corner Code #

Table with 3 columns: Item, Location (T/S), and Corner Code #. Includes items like Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Section.

REGISTER OF DEEDS DICKINSON COUNTY

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

Grid table with columns A-M and rows 2-13. Contains numerical data and a small diagram of a corner point.

I, Robert F. Perkins, in a field survey on Oct. 9, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:
K-12 1/4 Corner Common to Sections 35/36 Post by James H. Mullett, D.S. 1849 Original Bearing Trees Sugar 10" S70°E 13 Lks. Birch 10" N12°W 14 Lks.
L-11 1/4 Corner Common to Sections 36 Post by J.H. Mullett, D.S. 1849 Original Bearing Trees Hemlock 12" N40°E(M.B.) 21 Lks. Lynn 8" S60°W(M.B.) 20 Lks.

ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 12-9-97 ROP.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
K-12 No Evidence of Original Corner or Accessories Found. Found 1 1/2" Solid Iron Bar in North-South Fence with Remains of Obliterated Fence West. Iron Bar is identical to type set by Penn Iron Co. around 1900. Location agrees with G.L.O. Calls to Swamp and Creek North. Corner Researched in 1996 Remon. Program.
L-11 No Evidence of Original Corner or accessories Found. Found 5/8" Iron Bar at Old Fence Corner and 4 newer B.T.'s. Distance West along old Fence to Centerline RR Grade checks with 1892 E.I.M. & W. RR Map (413' Map-415' Meas.)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
K-12 Accepted above Described Iron Bar as Best Available Evidence of Corner Location. Set 3 1/2" Stamped D.C. Remon. Corner at Ex. Iron Rod. New Witnesses: Oak 7" S43°W(M.B.) 24.05' Nail/Tag Oak 12" N24°E(M.B.) 16.68' Nail/Tag Maple 6" S05°E(M.B.) 22.52' Nail/Tag R.Pine 5" N40°W(M.B.) 36.68' Nail/Tag Carsonite Stake North 0.5'
L-11 Accepted above described Location as Best Available Evidence of Corner Location. Replaced Iron Bar with 2 1/2" Stamped D.C. Remon. Corner. New Witnesses: Aspen 14" N60°W(M.B.) 13.62' Nail/Tag Aspen 6" S35°W(M.B.) 8.67' " " Lynn 12" S30°E(M.B.) 41.48" " " Lynn 8" S45°E(M.B.) 14.21' " " Carsonite Marker South 0.5'

Signed by [Signature] Surveyor's Michigan License No. 12027

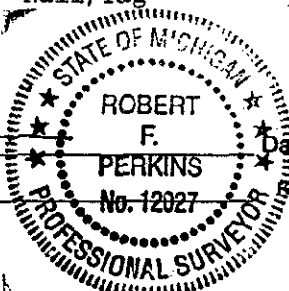

Date Nov. 26, 1997 FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN, 1983