

Common to T41 R29W
A-6
A-7

RECORDED

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

1998 DEC 14 11:25

For corners in

Dickinson	Located in:	Corner Code #
(County)		
Sagola Twp.		
1. Public Land Survey	T41NR 30W	M-6
	T___ R___	M-7
	T___ R___	
	T___ R___	
2. Property Controlling in Section	S___ T___ R___	
	S___ T___ R___	
3. Miscellaneous Property in Sec.	S___ T___ R___	
	S___ T___ R___	

REGISTERED OFFICE
 DICKINSON COUNTY
 300 MAIN ST. JACKSON, MI 48469

SURVEY &
 REMONUMENTATION

NOV 15 1998

SECTION Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Robert F. Perkins, in a field survey on Nov. 3, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

M-6 East 1/2 Corner, Section 13
 Post by Wm. A. Burt, D.S. 1846
 Original Bearing Trees
 W. Pine 16" S59°W 6 Lk.
 Y. Pine 18" N31°E 15 Lk.

M-7 Southeast Corner, Section 13
 Post by Wm. A. Burt, D.S. 1846
 Original Bearing Trees:
 Tamarack 11" S49°W 17 Lk.
 Tamarack 10" N12°E 21 Lk.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-6 Found 1" Iron Pipe Marker with 4" Brass Cap Set from G.L.O. BT by D.C. DeLaMater, RLS 10-28-1953.
 1953 Bearing Trees:
 J. Pine 14" S35°W 61 Lk.
 W. Pine 26" S43°E 227 Lk.

M-7 No Evidence of Original Corner or its Accessories Found.
 Found 1" Pipe Marker with 4" D.N.R. Brass Cap Set by D.C. DeLaMater, RLS 10-23-1953 (Old Corner Report #112)
 1953 Bearing Trees:
 Spruce 12" S27°W 47 Lk. (Found)
 Cedar 18" S13°E 72 Lk. (Found)


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-6 Found and Accepted Pipe Marker described in "B" above:
 New Witnesses:
 Spruce 11" S30°W(M.B.) 25.70' Nail/Tag
 W. Pine 3" S42°E(M.B.) 18.05' Nail/Tag
 DbL. Maple 8" N84°E(M.B.) 24.42' Nail/Tag
 Maple 5" N15°W(M.B.) 26.05' Nail/Tag
 Placed Carsonite Marker 0.80' West.

M-7 Found and Accepted Pipe Marker described in "B" above.
 New Witnesses:
 Spruce 10" N45°W(M.B.) 43.15' Nail/Tag
 Spruce 10" S74°W(M.B.) 33.78' Nail/Tag
 Spruce 14" S27°W(M.B.) 31.02' Nail/Tag
 Cedar 24" S13°E(M.B.) 47.52' Nail/Tag
 Placed Carsonite Marker 0.40' West.

Signed by Robert F. Perkins
 Surveyor's Michigan License No. 12027

Date Nov. 20, 1998

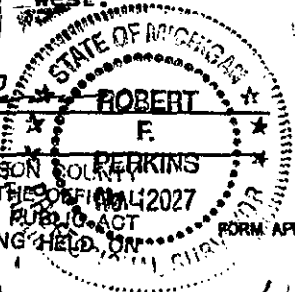

ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN ACT 345 OF 1990 AT A MEETING HELD ON 12-7-98

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1988
 REVISED MAY 14, 1990
 REVISED JAN. 1995
 REVISED OCT. 1997

Liber 2 Page 413

COUNTY REPRESENTATIVE