

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Dickinson</u>	Located in:	Corner Code #
(County)		
1. Public Land Survey	T41N R 29W	K9
	T41N R 29W	I8
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Sep 09 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	10	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

(K9) Corner common to Sections 23-24-25-26. Corner recorded in 1960 by Billy D. Buckler, RLS: "This corner was replaced from two pine B.T.'s in good condition. Corner lies in open marsh. Corner found by Forestry Division Survey Crew. Corner was placed and witnessed October, 1959. Corner monument: 1" pipe with 4" brass cap. Witnesses to corner: 20" W. Pine S45W 3.96 chains.

(I8) Quarter corner common to Sections 22-23. Corner re-monumented in 1963 by Billy D. Buckler, RLS: "This corner was placed by proportionate distance and on line bet. a section corner 1/2 mile to North and line tree approx. 11.5 chs. to South. Corner monument: 1" iron pipe with 4" aluminum cap. Witnesses: 6" Spruce N10W 29.5 links, 8" Cedar S72E 81.5 links."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(K9) Recovered the 1959 monument as described, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Natural Resources tablet, appropriately stamped, in good condition, at record bearing and distance from the 1959 W. Pine witness. Left the monument in place and marked new bearing trees as described below. Corner recovered and re-witnessed by B.Wheeler and D.Lampela, Baraga District Office.

(I8) Recovered the 1963 monument as described, a 1" ID iron pipe capped with a 4" dia aluminum State of Michigan tablet, in good condition, and at record bearing and distance from the 1963 witnesses. The Spruce is dead and leaning over, the Cedar is in good condition. Left the monument in place and marked new bearing trees as described below. Corner recovered and re-witnessed by B.Wheeler and D.Lampela, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K9) Found 1" pipe with 4" brass cap.
Blazed and scribed the following:
12" R. Maple S04E 126.6' S25 NBT"
Fd. following blazed and w/ meas. nail
4" Tamarack S56W 56.13' (to fd. nail)
4" Tamarack N22W 39.43' do
The 1959 witness:
28" W. Pine S49W 260.71' do
Bearings are magnetic. Dist. to R.
Maple is to notch in lower blaze.

(I8) Fd 1" pipe with 4" aluminum cap.
Blazed and scribed the following:
9" Spruce N37E 34.4' 1/4S NBT"
17" Cedar S07E 42.4' do
9" Spruce N27W 17.9' with alum. poster
The 1963 witness:
12" Cedar S70E 53.7' to face
Bearings are magnetic. Distances are to notch in lower blaze.

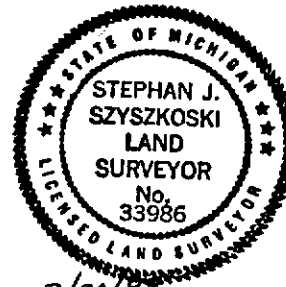

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 3/30/97

For the Michigan Department of Natural Resources - Forest Management Division