

**SURVEY &
REMONUMENTATION**

DEC 18 1995


COMMISSION

LAND CORNER RECORDATION CERTIFICATE 1995 FEB -0 AM 9:17
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Dickinson Located In: _____ Corner Code # _____
(County)

1. Public Land Survey	T <u>41N</u> R <u>30W</u>	<u>B-9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

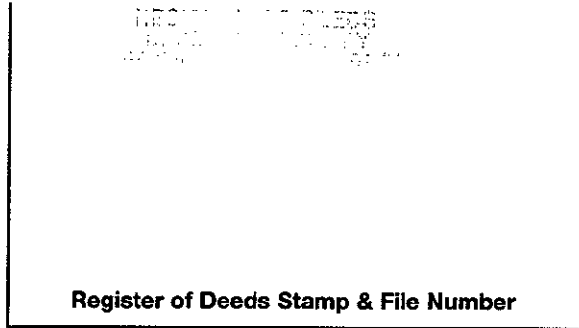

1/2 Corner common to Sections 19/30

I, Robert F. Perkins, in a field survey on Jan. 10, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9	●											
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

1849 Township Subdivision by John Burt, D.S.
Sugar 1/2 Section Post
Sugar 16" S30°E 46 L.
Sugar 16" S3°W 37 L.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of Original Corner or Accessories Remain.

Found Steel Drill Iron in Concrete at intersection of Ancient Fence Line East-West and North Corner accepted and used on many prior Surveys including Recorded Plat of Dow Riverside Subdivision.

ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 2-7-95
ROF
COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Steel Drill Iron in Concrete (existing).

New Witnesses

Fir 7" S36°E (M.B.) 55.50'

Basswood 14" N47°E (M.B.) 48.65'


S. Maple 3" N55°W (M.B.) 56.98'

3" Steel Gate Post N45°W 0.90'

Set Dickinson County Remonumentation Witness Corner 30.0 feet North of Fence Line.

Signed by Robert F. Perkins
Surveyor's Michigan License No. 12027

Date Feb. 3, 1995

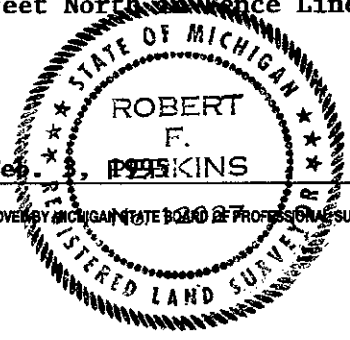

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

Suber 2 Page 146