

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
 (County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---------------------------------------|-----------|
| 1. Public Land Survey | T <u>42N</u> R <u>28W</u> | <u>L5</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S <u>12</u> T <u>42N</u> R <u>28W</u> | <u>14</u> |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Sep 24 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


- (L5) Quarter corner common to Sections 12-13. Reestablished in 1966 by F.J.Bray, RLS, by proportionate measurement. 1" iron pipe with 4" aluminum cap. 12" Elm S51E 31 links, 9" Elm S30W 32 links.
 (14-Sec.12) South 1/16 corner between Section 12 T42N-R28W and Section 7 T42N-R27W. Established in 1964 by F.J.Bray, RLS. 1" iron pipe with 4" aluminum cap. 6" Maple S30W 3.5 links, 6" S. Maple N46W 16 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (L5) Recovered the 1966 monument, as described, in good condition, at record bearing and distance from the two Elm NBT's now both dead. Left the monument in place and marked new bearing trees as described below.
 (14-Sec. 12) Recovered the 1964 monument, as described, in good condition, and at record bearing and distance from the Maple NBT SW, found in good condition. The other 1964 NBT is gone. Left the monument in place and made new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------|
| (L5) 1" pipe with 4" aluminum cap. | (14) 1" pipe with 4" aluminum cap. |
| Blazed and scribed the following: | Blazed and scribed the following: |
| 10" Maple N13E 15.8' "1/4S NBT" | 11" Sugar N75E 18.6' "1/16S BT" |
| 5" B.Ash S77E 6.3' do | 11" Sugar S55E 13.6' do |
| 8" Maple S23W 20.7' do | 8" Sugar S35W 2.3' overgrown blazes |
| 7" Sugar S76W 12.9' do | 10" Sugar N03W 26.1' "1/16S BT" |
| Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze. | Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze. |

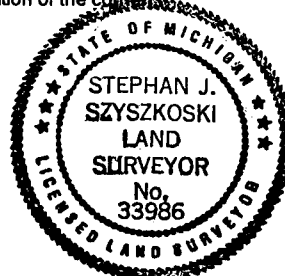

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 4/4/2000

For the Michigan Department of Natural Resources - Forest Management Division