

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
 (County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---|-------------|
| 1. Public Land Survey | T <u>42N</u> R <u>28W</u> | <u>16</u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| | T <u> </u> R <u> </u> | <u> </u> |
| 2. Property Controlling in Section | S <u>13</u> T <u>42N</u> R <u>28W</u> | <u>2</u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| 3. Miscellaneous Property in Sec. | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |
| | S <u> </u> T <u> </u> R <u> </u> | <u> </u> |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Sep 24 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:


- (16) Quarter corner common to Sections 14-15. Reestablished in 1966 by F.J.Bray, RLS, by proportionate measurement. 1" iron pipe with 4" aluminum cap. 6" Aspen N59E 24 links, 8" Aspen S03E 39 links.
 (2-Sec. 13) East 1/16 corner between Sections 12-13. Corner established in 1966 by F.J.Bray, RLS. 1" iron pipe with 4" aluminum cap. 7" Aspen S42E 14 links, 9" Aspen West 8.5 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (16) Recovered the 1966 monument as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum Michigan Dept. of Conservation tablet, with approximately 1/2 of the cap broken off, still set firm, at record bearing and distance from the 1966 Aspen NE in good condition, and from the dead and down remains of the Aspen SE. Left the monument in place and made new witnesses.
 (2-Sec. 13) Recovered the 1966 monument as described, in good condition, and at record bearing and distance from the remains of the 1966 Aspen NBT's. That SE is a 4' high stub, that West is a rotting stump mound. Left the monument in place and marked new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--|--|
| (16) 1" pipe with 4" aluminum cap. | (2) 1" pipe with 4" aluminum cap. |
| Blazed and scribed the following: | Blazed and scribed the following: |
| 8" Sugar N21E 12.9' "1/4S NBT" | 4" Ironwood N64E 27.4' "1/16S BT" |
| 7" Sugar N75E 27.3' do | 12" Sugar S74E 79.3' do |
| 12" Y. Birch S32W 62.9' do | 7" Spruce S20W 6.2' do |
| 10" Sugar West 42.0' do | 10" Sugar N19W 44.9' do |
| Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze. | Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze. |

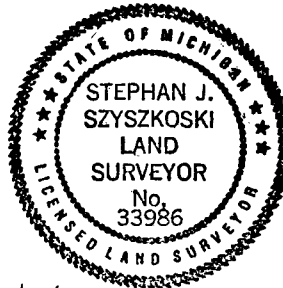

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 3/7/00

For the Michigan Department of Natural Resources - Forest Management Division