

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey	T	R	_____
	T	R	_____
	T	R	_____
	T	R	_____
2. Property Controlling in Section	S 17	T 42N R 28W	7
	S	T R	_____
3. Miscellaneous Property in Sec.	S	T R	_____
	S	T R	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jun 13 2005

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												


A. Description of original monument and accessories and/or subsequent restoration:
 (7-Sec. 17) North 1/16 corner between Sections 16 and 17. 1993: Remonumented and recorded by the undersigned at the position established in 1966 by F.J. Bray. Set 1" pipe with 4" MDNR cap. 8" Cedar N48W 37.6', 28" W.Pine N20W 32.0', 3" Sugar S87W 8.8', 5" Sugar N82E 45.0'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(7-Sec. 17) Found the 1993 monument in good condition and at record bearing and distance from three of the 1993 witness trees, in good condition with scribing visible. The Sugar to the NE is now dead and down. Accepted the monument and made new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(7) Found 1" ID I.pipe with 4" alum. MDNR cap. Set measuring nails in:
 3" Sugar S87W 9.0' *
 8" Cedar N46W 38.1' *
 29" W.Pine N18W 32.9' *
 4" W.Spruce S67E 34.5' mrdk "1/16S BT"
 Bearings are magnetic. Distances are to nail with tag. * denotes 1993 BT.

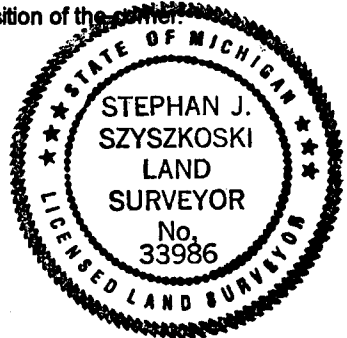

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 7/20/05