

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

DICKINSON COUNTY

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 42 N. XX , R. 29 XX W.	I-9
2. PROPERTY CONTROLLING IN SECTION _____	22, T. 42 N. XX , R. 29 XX W.	16
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970 the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on see below 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner I-9 (Section Corner 22, 23, 26, & 27, T42N, R29W):
 Sugar post (Not found. Found old circular mound of rocks.)
 Cedar 16 S55E 20 (Probably found. No subsequent accessories found.)
 Lynn 18 N67W 15 (Not found. " " " ")

Corner 16 (East 1/16 corner between Sections 22 & 27, T42N, R29W):
 Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner I9: On 4/22/76, placed new monument described below in the center of the old rock mound, from which found the down and badly decayed remains of a cedar stump at the bearing and distance given for the original cedar BT. The corner position falls N10 1/4° E 5.85 ft. from its position calculated from other corners, and checks exactly with original record distances to stream to N, a stream and ledge to E and top of a small knob to W, all of which tend to support the mound as marking the original corner. Vicinity has been used for the corner area as evidenced by an old fence cornering on a 14" elm S 1/4° W 24.3 ft. from the mound.

Corner 16: Established 7/9/76 on line between Sec. Cor. 1323.85 ft. E and 1/4 cor. 1323.85 ft. W. (See map on reverse side.)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner I9: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap, set in a rock mound.
 Sugar Maple 7 S20° E (mag.) 2.8 ft. "S26, NBT"
 Sugar Maple 9 N32° W (mag.) 22.6 ft. "S22, NBT"
 Sugar Maple 9 S52° W (mag.) 35.8 ft. "S27, NBT"

Corner 16: ⊕ chiselled in a solid rock ledge.
 Red Maple 5 S76° E (mag.) 58.5 ft. "1/16S, BT"
 Red Maple 6 S66° W (mag.) 32.1 ft. "1/16S, BT"


SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE October 24, 1977

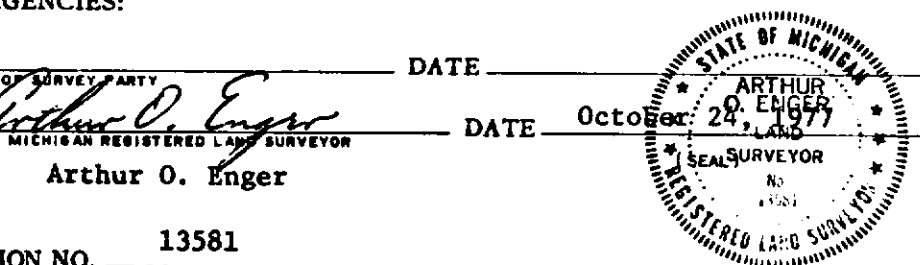

Arthur O. Enger

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581