

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
 (County)

Located In: Corner Code #

- | | | |
|------------------------------------|---------------------------------------|------------|
| 1. Public Land Survey | T <u>43N</u> R <u>28W</u> | <u>J10</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S <u>26</u> T <u>43N</u> R <u>28W</u> | <u>5</u> |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jun 11 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	10		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		●		25	
11												
12	31		32		33		34		35		36	
13												


- A. Description of original monument and accessories and/or subsequent restoration:
 (J10) Center of Section 26. Not established in the original survey.
 (5-Sec. 26) North 1/16 corner, Section 26. Corner not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (J10) Established the corner at the intersection of straight lines connecting opposite Quarter corners.
 (5-Sec. 26) Established the corner midway and on a straight line between Center of Section 1325.49' south and Quarter corner 1325.49' north.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--|--|
| (J10) Set 1"x32" iron pipe with 4" dia.
alum. MDNR cap. Blazed and scribed: | (5) Set 1"IDx32" iron pipe with 4" dia.
alum. MDNR cap. Blazed and scribed: |
| 8" B.Spruce N78E 38.9' "C1/4 BT" | 8" Maple N41E 26.0' "1/16S BT" |
| 6" B.Spruce S27E 9.5' do | 6" W.Spruce S20E 13.8' do |
| 6" Tamarack S13W 24.8' do | 8" R.Pine S37W 10.9' do |
| 12" Tamarack N82W 23.8' do | 7" R.Pine N17W 12.3' do |
- Set squared tam'k post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
- Set sq'd spruce post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

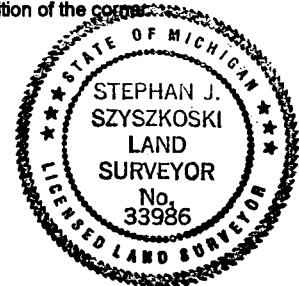

Signed by Stephan J. Szyszkoski Date 7/18/01
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division