

SURVEY & REMONUMENTATION

APR 27 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

FILED
copy

94 NOV -3 AM 11:22

For corners in
EATON COUNTY
(County)
BROOKFIELD TOWNSHIP

Located In:	Corner Code #1
T <u>1N</u> R <u>4W</u>	<u>B-8</u>
T _____ R _____	_____
T _____ R _____	_____
T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____

LINDA M. TWITCHELL
REGISTER OF DEEDS
EATON COUNTY, MICH.

LIBER 3 PG 479

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, DAVID R. LOHR, in a field survey on OCTOBER 4, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


- B-8: 1. CORNER WAS NOT SET DURING ORIGINAL SURVEY OF 1825.
2. NO RECORD OF SUBSEQUENT SURVEYS IN COUNTY SURVEYOR'S RECORD.
3. PRIVATE SURVEYOR'S RECORDS REVEAL NO ADDITIONAL DATA.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-8: FOUND ANCHOR POST AT FENCELINE CORNER. HAND EXCAVATED AREA AROUND ANCHOR POST. FOUND SMALL POINTED STONE AND REMAINS OF RED RIBBON. NO EVIDENCE FOUND REGARDING EXISTENCE OF CORNER AT THIS LOCATION. TRAVERSED SECTION AND SET 3/4" X 24" STANDARD REMON. BAR AT INTERSECTION OF 1/4 LINES. CORNER FALLS 9.0' SOUTH X 5.4' WEST OF ANCHOR POST LOCATION.
DISTANCE NORTH 2646.56 FT. DISTANCE SOUTH 2654.03 FT.
DISTANCE EAST 2645.48 FT. DISTANCE WEST 2636.83 FT.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-8: SET STANDARD 3/4" X 24" REMON. BAR WITH PA 345 CAP H30090 AT INTERSECTION OF 1/4 LINES. WITNESSED BY:
SET N/T 30090 N/S OF 12" ELM AZ. 341° 4.12'
SET N/T 30090 E/S OF 15" ELM AZ. 256° 7.90'
SET N/T 30090 W/S OF 6" ELM AZ. 38° 6:50'
SET N/T 30090 S/S OF 8" POST AZ. 61° 16.38'
SET N/T 30090 E/S OF 6" POST AZ. 20° 22.17'
TRAVERSE POINT BR1-26-11 AZ. 349° 93.60'

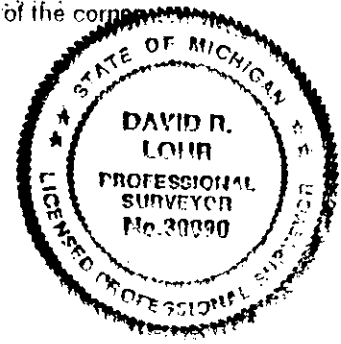

Signed by David R. Lohr Date OCTOBER 25, 1994

Surveyor's Michigan License No. 30090 P.A. 345 EATON COUNTY

PEER APPROVED 10/26/94 M