SECTION


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970		
For corners in		LINDA M. TWITCHELL
EATON	Located In: Corner Code #	REGISTER OF DEEDS EATON COUNTY, MICH.
(County) KALAMO TOWNSHIP		
1. Public Land Survey	T <u>2N R 6W B-10</u>	* E (MAN)
	TR	-
2. Property Controlling in Section	STR ST_R	0
3. Miscellaneous	S TR	$oxedsymbol{\mid}$ Liber $oxedsymbol{3}$ Page $oxedsymbol{952}$
Property in Sec.	S TR	Register of Deeds Stamp & File Number

, Recorded Plat 4. Lot No. 5. Private Claims

David R. Lohr , 19 98_ do hereby state that under in a field survey on $\frac{4/20}{}$ requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

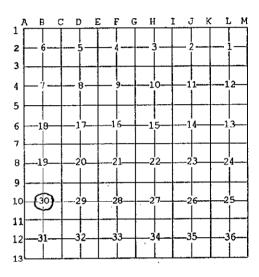

- A. Description of original monument and accessories and/or subsequent restoration:
- B-10: 1. POST NOT SET IN ORIGINAL GOVT. SURVEY.
 - 2. CORNER REFERENCED IN SURVEY BY OSCAR CHURCH, COUNTY SURVEYOR.

DATED SEPT. 1876 AND RECORDED IN VOL. 2 PG. 37. AS "STAKE",

WITNESSED BY: BEECH 14" S 77 3/4 W, 31 LKS, (20.46')

BEECH 8" N 74 1/2 E, 22 LKS, (14.52')

SURVEY SHOWS DISTANCE NORTH OF 39.43 CH. (2602.38'), EAST OF 39.92 CH. (2634.72') DISTANCE SOUTH OF 40.57 CH. (2677.62'), AND DISTANCE WEST OF 45.02 CH. (2971.32')

3. NO OTHER REFERENCES FOUND.

- Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- B-10: TRAVERSED ENTIRE SECTION AND SET CORNER ON SOUTH SIDE OF ANCHOR POST AT INTERSECTION OF FENCES NORTH-SOUTH AND EAST-WEST. LOCATION FALLS 3.38 FEET NORTH AND 9.91 FEET EAST OF INTERSECTION OF 1/4 LINES. ACCEPTED LOCATION OF ANCHOR POST AS CORNER BASED ON CHURCH'S SURVEY OF 1876, AND LOCATION OF C-10 AND OCCUPATION ALONG EAST-WEST 1/4 LINE. ANCHOR POST FALLS 1.12 FEET WEST OF DOUBLED DISTANCE FROM C-10 WEST ALONG EAST-WEST 1/4 LINE. SET 3/4" X 24" STANDARD RE-MON. BAR AND PA 345 CAP STAMPED 30090 ON SOUTH SIDE OF ANCHOR POST. NO EXCAVATION WAS PERFORMED. MEASURED EAST 2640.60 FT., SOUTH 2654.87 FT., WEST 2974.79 FT. AND NORTH 2605.01 FT.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

B-10: SET 3/4" X 24" STANDARD REMON. BAR AND PA 345 CAP STAMPED #30090 ON SOUTH SIDE OF ANCHOR POST. WITNESSED BY:

AZ. 02 DEG. 27.60' AZ. 89 DEG. 27.00' SET N/T #30090, W/S 12" ASH, SET N/T #30090, S/S 2" ASH, SET N/T #30090, W/S 40" STUMP, AZ. 180 DEG. 10.30'

SET N/T #30090, SE/S 20" ASH AZ. 240 DEG. 36.50' SET N/T#30090, N/S 18" ASH, AZ. 273 DEG. 32.60'

Signed by Surveyor's Michigan License No. 30090

Date 9-18-98

MICHIGAN

DAVID R. LOHR

PROFESSIONAL

No.30090

POFESSIONA