

**1998 GENESEE COUNTY REMONUMENTATION PROGRAM  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Genesee County Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_

- 1. Public Land Survey T5N R6E K-5
- 2. Property Controlling S\_\_\_ T\_\_\_ R\_\_\_
- in Section S\_\_\_ T\_\_\_ R\_\_\_
- 3. Miscellaneous S\_\_\_ T\_\_\_ R\_\_\_
- Property in Sec. S\_\_\_ T\_\_\_ R\_\_\_

SURVEY &  
REMONUMENTATION

MAR 17 1999

MASTER LIBER 4013 PAGE 97

106825

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_ SECTION \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

I, Kevin B. Cleaver, in a field survey on November 24, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		16	
13													

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

**A. Description of original monument and accessories and/or subsequent restoration:**

- 4-15-1823 General Land Office (GLO) fieldnotes: set post w/two accessories
- 8-29-1989 unrecorded survey by A.F. Miller in SW 1/4 Section 12: set roerod/cap # 12024 with four accessories
- 6-1-1948 Recorded plat of "Log Cabin Point Annex": Corner K-5 is depicted on plat map and dimensioned from various lot corners

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

GLO corner and accessories not found  
 Recovered corner only as identified on 1989 unrecorded survey  
 Confirmed within acceptable tolerance 1948 platted dimensions to corner from lot corners in "Log Cabin Point Annex"  
 The monument found was ratified by the Genesee County Remonumentation Peer Review Committee on November 18, 1998

GENESEE COUNTY  
REGISTER OF DEEDS  
DEC 11 10 53 AM '98  
*M. L. ...*


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Set the standard Bernsten monument SS-A-5BR-30 with 3 1/4" brass cap stamped "Genesee County Remonumentation Corner, 1998, #29242" over 1/2" roerod

- S 35° W 93.48' set nail/tag in NW face 12" elm
- N 65° W 121.35' set nail/tag in SW face twin 12" ash
- N 50° E 15.74' set nail/tag in NW face twin 6" tree
- N 70° E 98.23' set nail/tag in N face 12" poplar

Ratified by Peer Group in accordance with P.A. 345, 1990  
 Co. Rep. Carl ...  
 Date 11-18-98

Signed by Kevin Banfield Cleaver  
 Kevin Banfield Cleaver, P.S.

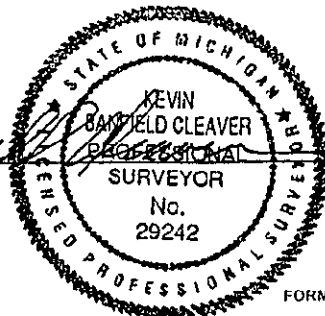

Date 12/8/98

Surveyor's Michigan License No. 29242