

GLADWIN COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 001 PAGE 199

For corners in

<u>GLADWIN</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 17N R 1E	K-8
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

STATE OF MICHIGAN
GLADWIN COUNTY
FILED Remonumentation

17 OCT 97 1:24 P.M.

BONNIE K. HOUSE
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, MARK R. ROBISON, in a field survey on July 2, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

1831 Henry Parke
Set Post
Wit.-(1)N50W 9 links 30" Pine
(2)S35E 22 links 20" Pine

1977 Edmands L.C.R.C.#186
Iron
Wit.-(3)56.5 WSW T. Pole
(4)79.45 NNW P. Pole
(5)33.6 E. Fence Cor.

1992 Lapham survey
Wit.-same as (3),(4)&(5)

1993 Lapham survey
Wit.-same as (3),(4)&(5)

1996 Lapham survey
Found P.K. nail
Wit.-(6)N85E 28.22 P.P.
(7)N35W 79.58 P.P.
(8)East 34.04 Cor Post
(9)N55W 91.85 18" Oak

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 3/8" rerod, 0.75 ft. below surface of North & South bituminous road opposite old fence corner & fence East--agrees with witnesses (4), (6), (7) & (9). Set Gladwin County Re-mon in place of found 3/8" rerod.

See dossier for detailed report.

APPROVED LAND CORNER
P.A. 345 of 1990
Gladwin County

Co. Rep. [Signature]
Date 9/18/97

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


K-8: Corner common to Sections 23 & 24.
Set 5/8" x 36" rerod with Gladwin County Re-mon Cap marked
P.S.#27458 in Monument Box.
Witnesses:
N85E Power Pole, nail & tag, 28.22'
North, P.K. nail, 2.0'
N35W Power Pole, nail & tag, 79.58'
East, P.K. nail, 2.0'
N55W 24" Oak, nail & tag, 91.85'
S75W Triple 10" Oak, nail & tag, 109.65'

SURVEY &
REMONUMENTATION

JAN 08 1998

SECTION

Signed by Mark R. Robison
Surveyor's Michigan License No. 27458

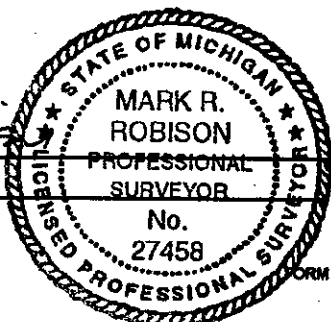

Date 10-7-97