

SURVEY & REMONUMENTATION

SEP 07 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Gladwin County Remonumentation

LIBER 001 PAGE 256

SECTION

For Corners in
GLADWIN

(County)

Located In:

Corner Code#:

- 1. Public Land Survey T. 17N R. 2W C-4
 T. _____ R. _____
 T. _____ R. _____
- 2. Public Controlling in Section S. _____ T. _____ R. _____
 S. _____ T. _____ R. _____
- 3. Miscellaneous Property in Section S. _____ T. _____ R. _____
 S. _____ T. _____ R. _____
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

STATE OF MICHIGAN
 GLADWIN COUNTY
 Filed-Remon

16 AUG 1999 2:31:55 PM

DONWIE K. HOUSE
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Mark R. Robison, in a field survey on May 4, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

A. Description of original monument and accessories and/or subsequent restoration:

- 1850 William A. Burt Set QR. Post
 Wit-(1)Beech 7 S6E 14
 (2)Do 6 N25W 23
- 1974 Lapham survey
 Wit-same as (3), (4) & (5)
- 1972 Lapham LCRC#32B & LCRC#45, survey, & working drawing
 Found 1/2" Iron
 Wit-(3)East 52.30 P.P.
 (4)West 40.75 P.P.
 (5)N50E 67.30 30" Pine Stump
- 1977 Edmands Eng. county road plans
 1" Pipe
 Wit-(6)W 40.5 Face P.P.
 (7)E 51.9 Face P.P.
 (8)NE 102.8 1" Spruce
- 1996 Lapham survey
 Found P.K. Nail
 Wit-same as (3) & (4)
- 1981-91 Lapham 3 surveys
 Wit-same as (3), (4) & (5)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Found P.K. Nail over 1/2" x 18" roerd (old). Agrees with witnesses (3), (4) & (8). Also agrees with Edmands Engineering (1977) and Lapham (1972) & (1996) measurements to C-5 & C-3. Set 5/8" roerd in place of found 1/2" Iron.

See dossier for detailed report.

APPROVED LAND CORNER


P.A. 345 of 1990
 Gladwin County

Co. Rep. [Signature]
 Date 8/13/99

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-4: Set 5/8" x 36" roerd with Gladwin County Remonumentation cap marked P.S.#27458 in Monument Box.

- Witnesses:
 East Power Pole, nail & tag, 52.00'
 West Power Pole, nail & tag, 40.50'
 N15°E 10" Spruce, nail & tag, 102.75'
 S30°W 4' x 2.5' Stone pointed, North End 90.30'

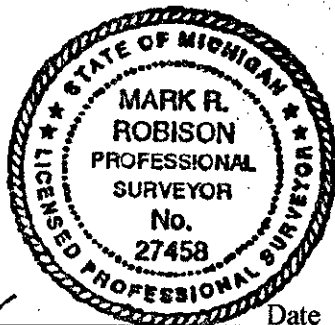

Signed by Mark R. Robison Date 8-10-99
 Surveyor's Michigan License No. 27458