

Gladwin County Remonumentation

PAGE 23

FEB 1 8 1994

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

114 25 33 AM

Digital in	S. Marine
8 France	ment 4
Fire (
Lonnie.	Douga

Register of Deeds Stamp & File Number

For corners in COMMISSION Gladwin Located In: Corner Code ## (County) T_18N_R _1E_ 1. Public Land Survey T _18N_R __1E_ T _____ R ___ T _____ R _ S _____ T _____ R ____ 2. Property Controlling

S ____ T ___ R ____

S ____ T ___ R ____

___ , Recorded Plat ___

Craig W. McVean

in Section

Miscellaneous

Property in Sec.


Private Claims _

October 29 . in a field survey on

93

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

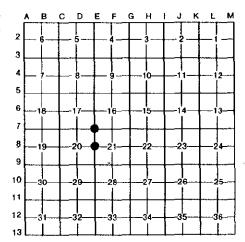

Description of original monument and accessories and/or subsequent restoration:

Intersect principle meridian 3.36 Ch. S of corner of Sec. 12&13, T18N, R1W, J. Mullet, 1847. Set post at intersection for Sec. 16&21, T18N, R1E.

B. Ash 8" N 62° E 16 Lks.

B. Ash 8" S 63° E 22 Lks.

E-8 Not set in original survey.

M.D.O.T. witness card - 1961 - Gilbert - 3/4" rod in mon. box.

M.D.O.T. witness card - 1975 - Bennett - 3/8" iron in mon. box.

L.C.R.C. - P. 109 - 1975 - Hooth.

Recorded Survey, L. 1, P. 904 - 1978.

M.D.O.T. witness card - 1961, Gilbert - 3/4" rod in mon. box. M.D.O.T. witness card - 1975, Bennett rod in mon. box. L.C.R.C. - P. 128, 1975 - Hooth (M.D.O.T.)

Dundas - witness - prior to 1958.

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-7 Closing corner common to Sec. 16&21, T18N, R1E. Found 3/4" iron rod in mon. box per L.C.R.C. and M.D.O.T. witness cards. Fits GLO closing to M5-T18N-R1W. Monument accepted as the best available evidence of the position of the original corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

E-8 1/4 corner common to Sec. 21, T18N, R1E. Found 3/4" iron rod in mon. box per L.C.R.C., M.D.O.T. witness cards, and recorded survey. Fits occupation fence to E and M.D.O.T. call to M6-T18N-R1W. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

TE OF MICHIGAL CRAIG W. McVEAN **PROFESSIONAL** SURVEYOR No.

C. Description of monument for corner and description established to perpetuate locating the position of the corner:

F-8 Could not remove 3/4" rod - drove down.

Set Gladwin County aluminum cap on 5/8" x 24" rebar over rod in mon. box -0.15' E of standard line, and 1.2'+ W of centerline M-30. N 86° E 152.97' to nail and tag in S side 14" Ash. SE 83.62' to nail and tag in NE side P.P. SW 83.22' to nail and tag in SE side P.P. S 70° W 93.57' to nail and tag in SE side 12" Cedar. N 20° W 187.17' to nail and tag in E side P.P. N 30° E 62.40 to face 4" pipe - oil line marker. W 0.15' and N 221.84' (220.90' M.D.O.T. and 221.76' (GLO)) to M5-T18N - R1W.

Set Gladwin County aluminum cap on 5/8" x 36" rebar over rod in mon. box.

S 19° W 169.20' to nail and tag in W side P.P.

S 74° W 35.42' to nail and tag in N side 4" Pine.

N 87° W 102.66' to nail and tag in N side 8" Pine.

N 20° W 168.54' to nail and tag in S side P.P.

S 75° W 54.82' to nail and tag in S side 2" Birch.

North 242.48 (242.50 - M.D.O.T.) to M-6 - T18N - R1W.

Signed by Oracy W. Ma Vem Date 12/20/93 Surveyor's Michigan License No. 39088