

FEB 18 1994


DEC 29 93 AM

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Gladwin

(County)	Located In:	Corner Code --#
	18N 1E	E-13
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

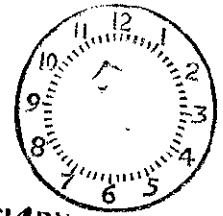

GLADWIN COUNTY REGISTER OF DEEDS
Donna Jones

Register of Deeds Stamp & File Number

Craig W. McVean

October 26

93

I, _____, in a field survey on _____, 19 _____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- E-13** Intersect Meridian 4.70 CH. S of corner of Sec. 25 and 36 T18N, R1W - R. Clark, 1831.
- Hemlock 20" N 20° E 27 Lks.
- Hemlock 10" S 32° E 24 Lks.
- M.D.O.T. witnesses card - Gilbert - 1961 - 3/4" rod in mon box.
- L.C.R.C. - P. 175 - McGinnis - 1977 - set iron.
- L.C.R.C. - P. 324 - Case - 1989.
- Recorded survey L. 2, P. 233 - 1986; L. 1, P. 854 - 1978; L. 1, P. 178 - 1972.
- M.D.O.T. ROW plans - File No. 26 - R - 2 - Cont. Sec. 26031 Sheet 30.
- Dundas - iron pipe and witness - prior to 1958.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- E-13** Closing Township corner for Sec. 33, T18N, R1W and Sec. 4, T17N, R1W. Found 3/4" iron rod in mon. box per L.C.R.C. - P. 324 and M.D.O.T. witnesses card. Monument accepted as the best available evidence of the position of the original corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- E-13** Replace 3/4" iron rod with 2" Gladwin County aluminum cap on 5/8" rebar in mon. box on standard line - 1.6'± E of centerline M-30.
- S 75° E 144.93' to nail and tag in N side twin 12" Maple.
- N 75° E 102.69' to nail and tag in S side 8" Pine.
- N 35° E 109.05' to nail and tag in NE side P.P.
- S 50° W 82.06' to nail and tag in SE side P.P.
- North 310.69' (310.60' M.D.O.T. and 310.20' GLO) to M-11 - T18N - R1W.



Signed by *Craig W. McVean*

Date 12/20/93

Surveyor's Michigan License No. 39088