

**SURVEY & REMONUMENTATION**

OCT 23 1998

GLADWIN County Remonumentation

SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 001 PAGE 232

For corners in

<u>GLADWIN</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T18N R01E	M-5
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

STATE OF MICHIGAN  
GLADWIN COUNTY  
FILED-CORNER

13 OCT 1998 12:48:41 PM

BONNIE K. HOUSE  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Mark R Robison, in a field survey on April \_\_\_\_\_, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mention in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate**

A. Description of original monument and accessories and/or subsequent restoration:

- M-5: 1837 Lewis Glason**  
Set Sec Cor Post Sec 12 & 13  
Wit-(1)Hem 10 N49W 25  
(2)W. Pine 20 S10W 7  
1992-1997 DNR survey, work dwg & LCRC#364  
Found 1/2" roerod  
Wit-(7)16" W. Pine N60W 47.67  
(8)38" W. Pine N25E 85.62  
(9)9" Maple S55E 52.20  
(10)12" Maple S50W 37.33
- 1977 Lapham (survey) Set 1/2" x 18" C.I.  
Wit-(3)N60W 6" Pine 48.44  
(4)S40E 30" Pine 28.40  
(5)S40W Tw. Maple 37.33  
(6)S25W 3" Birch 42.10  
1982 Lapham LCRC#262  
Wit-same as (3), (4), (5)  
1996 Lapham survey Fd 1/2" roerod  
Wit-same as (8), (9), (10)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- M-5: Found 1/2" x 36" roerod in centerline of old road way South, 4 ft. South of centerline of East-West road. Found 1/2" x 18" roerod in horizontal position, bent to U-shape 0.5+/- North of found 1/2" x 36" roerod--agrees with witnesses (5), (8), (9) and (10). Accepted 1/2" x 36" roerod as corner location. Replaced with Gladwin County Remonumentation.** See dossier for detailed report.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


- M-5: Corner common to Sections 12 & 13, on township line. Set 5/8" x 36" roerod with Gladwin County Remonumentation cap marked P.S.#27458.**

Witnesses:

- S50W 12" Maple, spike, 37.57'  
N25E 36" White Pine, spike, 85.62'  
S55E 9" Maple, spike, 52.20'  
S43E 6" White Pine, nail & tag, 82.85'  
N45W 6" White Pine, nail & tag, 86.10'

APPROVED LAND CORNER  
P.A. 345 of 1990  
Gladwin County

Co. Rep. [Signature]  
Date 8/11/98

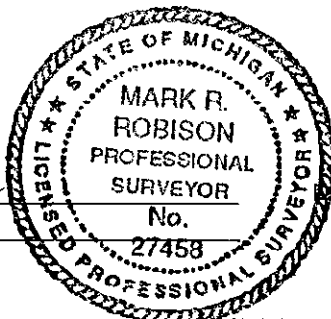

Signed by [Signature]  
Surveyor's Michigan License No. 27458

Date 10-5-98