

SURVEY &
REMONUMENTATION
APR 07 1995
COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

PAGE 40

For corners in

GLADWIN
(County)

Located In:

Corner Code #

- | | | | | | |
|------------------------------------|---|-----|---|----|-----|
| 1. Public Land Survey | T | 18N | R | 1W | K-8 |
| | T | | R | | |
| | T | | R | | |
| | T | | R | | |
| 2. Property Controlling in Section | S | | T | R | |
| | S | | T | R | |
| 3. Miscellaneous Property in Sec. | S | | T | R | |
| | S | | T | R | |

STATE OF MICHIGAN
GLADWIN COUNTY
RECORDED

28 DEC 94 2:58 P.M.

BONNIE K. HOUSE
REGISTER OF DEEDS
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, PAUL B. LAPHAM, in a field survey on NOVEMBER, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23	●	24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1877 T. GALE MERRILL
SET OR SECTION POST
WIT.-PINE 22° N12°W 18
DO 24° S61°E 05

1985 LAPHAM
SET CAPPED IRON
WIT.-S45°W GATE SOUTH 6" LEG 45.42'
S80°W GATE NORTH 6" LEG 26.03'
S35°E ● TOP SHUT OFF VALVE 46.80'

APPROVED LAND CORNER
P.A. 345 of 1990
Gladwin County

Co. Rep. J.P. Meyer
Date 12-2-94

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


FOUND 1/2" BENT C.I., 12" POST EAST, WITH FIELD LINE & OLD FENCE DOWN & OUT, DITCH TO WEST, & OF DRVE TO WEST, 20± SOUTH OF CORNER. SEARCHED-FOUND NO OTHER CORNER EVIDENCE.
FOUND: S45°W GATE SOUTH 6" LEG 45.42', MEAS. 45.40'
S80°W GATE NORTH 6" LEG 26.03', MEAS. 26.11'
S35°E ● TOP-SHUT OFF VALVE 46.80', MEAS. 46.40'
SET COR. FROM LAPHAM'S WITNESSES AND FOUND 1/2" CAPPED IRON

Accepted as best available evidence of the position of the original corner & replaced with Standard Monument.

Corner, K-8 was approved for remonumentation at a Peer Review Committee Meeting on 12/2, 19 94.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-8: Corner common to Sections 23 & 24
SET 5/8" x 36" RE-ROD WITH GLADWIN COUNTY RE-MON CAP, MARKED P.S. #9433.
WITNESSES:
EAST 12" COR. POST 27.82' - NAIL & TAG
S80°W 6" METAL GATE POST (MARKED +) 27.23'
S45°W 6" METAL GATE POST (MARKED +) 42.70'
S45°E 1/2"x36" RE-ROD, 8" BELOW SURFACE GROUND 46.20'

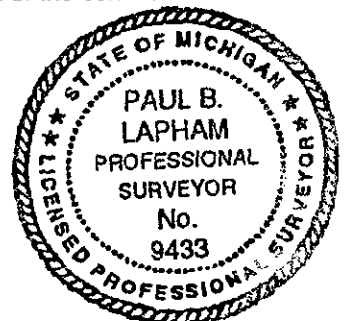

Signed by Paul B. Lapham Date 12-23-94
Surveyor's Michigan License No. 9433