

FEB 1 8 1994

Gladwin County Remonumentation

PAGE 19

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

DLC 29 '93 AM

For corners in MMISSION


Gladwin		Located In:	Corner Code ##
	(County)		
1.	Public Land Survey	T_18N_R_1W	M-5
		T <u>18N</u> R <u>1W</u>	(M-6)
		T R	
		T R	
2.	Property Controlling	S T R	
	in Section	S T R	
3.	Miscellaneous	S T R	
	Property in Sec.	S T R	

SADVA JOUR TOUR

Register of Deeds Stamp & File Number

1.	Lot No, Recorded Plat
5.	Private Claims

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

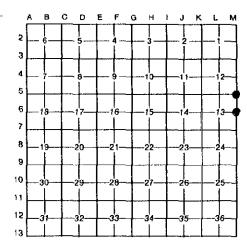

A. Description of original monument and accessories and/or subsequent restoration:

M-5 Set post by J. Brink, 1837. Birch 12" S 50° W 28 Lks. White Pine 18" N 54° W 14 Lks.

GLO Resurvey - T. Merril - 1877.

GLO Hesurvey - T. Merril - 1877. M.D.O.T. witnesses card - Gilbert, 1961 - 3/4" rod in mon. box. M.D.O.T. witnesses card - Bennett, 1975 - 3/4" rod in mon. box.

L.C.R.C. - P. 130 - Hooth, 1975. M.D.O.T. right-of-way sheet - file #26-R-2, control sec. 26031, sheet #31.

Dundas - 1" iron pipe and witness - prior to 1958.

M-6 Set post by J. Brink, 1837. White Pine 11" \$ 79° W 34 Lks. Maple 10" N 43° W 10 Lks.

GLO Resurvey - T. Merrill - 1877
M.D.O.T. witnesses card - Gilbert, 1961 - 3/4" rod in mon. box.
M.D.O.T. witnesses card - Bennett, 1975 - 5/8" in mon. box.
L.C.R.C. - P. 111 - Hooth, 1975.

Dundas - 1" iron pipe and witness - prior to 1958.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-5 Standard Sec. corner common to Sec. 12&13, T18N, R1W. Found 3/4" iron rod in mon. box per M.D.O.T. witnesses card and L.C.R.C. Monument accepted as the best available evidence of the position of the original corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

CRAIG W.
MCVEAN
PROFESSIONAL
SURVEYOR
No.
39088

M-6 Standard 1/4 corner common to Sec. 13, T18N, R1W. Found bent 3/4" iron rod in mon. box per L.C.R.C. and M.D.O.T. witnesses cards. Monument accepted as the best available evidence of the position of the original corner. Accepted by Gladwin County Peer Review Group on 12-10-93.

C. Description of monument for corner and accessive established to perpetuate locating the position of the corner:

M-5 Replaced 3/4" iron rod with 2" Gladwin County alum. cap on 5/8" x 36" rebar in mon. box - 1.7' + W of centerline of M-30. N 50° W 50.09' to nail and tag in NE side of fence corner post. N 54° W 46.85' to road sign post. N 80° E 55.89' to nail and tag in N side 3" Ash. S 70° E 21.02' to capped 3/8" rebar. S 75° E 24.93' to centerline N leg of road sign. S 53° W 74.40' to nail and tag in E side P.P. S 221.84' (220.90' M.D.O.T. - 221.76' - GLO) and 0.15' E to closing corner E7-T18N-R1E.

M-6 Replaced 3/4" iron rod with 2" Gladwin County alum. cap on 5/8" x 36" rebar in mon. box - 7'± W of centerline of M-30. N 44° W 101.24' to nail and tag in SW side 8" W. Pine. S 33° W 101.60' to nail and tag in W side P.P. N 60° E 191.44' to SE corner Cem. Bik. Building (Bar). N 48° E 142.10' to SW corner Cem. Bik. Building (Bar). N 34° E 190.47' to NW corner Cem. Bik. Building (Bar). S 242.48' (242.50' M.D.O.T.) to closing corner E8-T18N-R1E.

Signed by Ornic, W. Me Ven	, ,	
Signed by Cruze W. The Ven	Date 12/20/93	
Surveyor's Michigan License No. 39088	, ,	