


# LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: <u>Gladwin</u> (County)	Located In	Corner Code #
1. Public Land Survey	T <u>20N</u> R <u>2E</u>	<u>F9</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No: _____ Recorded Plat: _____		
5. Private Claims: _____		

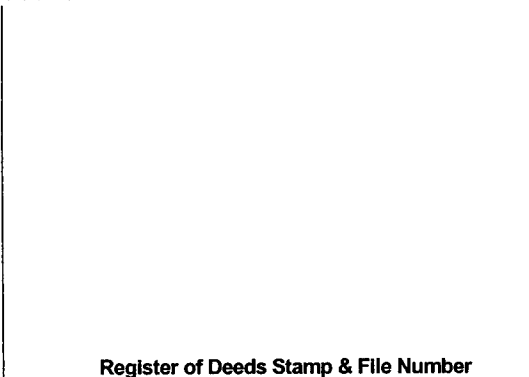

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5				4		3		2		1	
3													
4	7	8				9		10		11		12	
5													
6	18	17				16		15		14		13	
7													
8	19	20				21		22		23		24	
9						●							
10	30	29				28		27		26		25	
11													
12	31	32				33		34		35		36	
13													

I, Craig W. McVean, in a field survey on March 7, 2006 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

F9 – GLO – Set ¼ Post – J. Mullet – 1846  
 W. Pine 14" N60°W 8 L.  
 W. Pine 8" S22°E 32 L.  
 - CCC Notes – 1930's – West between Sec. 21-28 – 280.00 - Set Random ¼ post.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

F9 – ¼ Common to Sections 21 & 28 - Found no conclusive GLO evidence. Set 4" Aluminum DNR cap on 1" x 5' long galvanized iron Pipe by single proportionate to GLO between reestablished 'E9' and 'G9'. Mon. in leather leaf marsh. DNR Monument accepted as a careful and faithful reestablishment of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

F9 – 4" Aluminum DNR Cap on 1" x 5' long galv. iron pipe.  
 N58°W 108.81' to set N & T in NE side 7" Oak scribed 'XBT'  
 N29°W 116.77' to set N & T in E. side 22" Tamarack scribed 'XBT'  
 N67°E 85.03' to set N & T in S. side 7" Oak scribed 'XBT'  
 S7°W 49.33' to set N & T in W. side 7" Tamarack scribed 'XBT'  
 Set Blue Carsonite Post 1' East.



Signed by: Craig W. McVean Date: 5/9/2007  
 Surveyor's Michigan License No.: 39088