

**SURVEY & REMONUMENTATION**

GLADWIN COUNTY REMONUMENTATION

DEC 16 1996

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

LIBER **001** PAGE **156**

For corners in **COMMISSION**

GLADWIN (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>20N</u> R <u>1W</u>	<u>G - 10</u>
	T <u>    </u> R <u>    </u>	<u>    </u>
	T <u>    </u> R <u>    </u>	<u>    </u>
	T <u>    </u> R <u>    </u>	<u>    </u>
2. Property Controlling in Section	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>
	S <u>    </u> T <u>    </u> R <u>    </u>	<u>    </u>

STATE OF MICHIGAN  
GLADWIN COUNTY  
FILED-REMONUMENTATION

2 DEC 96 3:35 P.M.

BONNIE K. HOUSE  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, MARK ROBISON, in a field survey on November, 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

1856 GEO E. ADAIR  
SET 1/4 POST  
WIT.-(1)HEMLOCK 12 N51W 24  
(2)MAPLE 7 S72E 7

1994 PAUL LAPHAM SURVEY  
FOUND 1/2" IRON  
WIT.-(4)N45W 63.16 P.P.  
(5)N38E 84.18 P.P.  
(6)N85E 62.50 6" PINE

1907 KNOX SURVEY  
FOUND GAS PIPE  
WIT.-(3)PINE STUMP 16 S87E 41 LINKS

1973 PAUL LAPHAM SECTION SUBD.  
WIT.-NONE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" X 18" REROD 1.0' BELOW SURFACE IN ASPHALT ROAD WITH 1" RUST BALL ON BOTTOM, OPPOSITE FIELD LINES E & W. FOUND (4); MEAS. 63.21, REC. 63.16. FOUND (5); MEAS. 84.18, REC. 84.11. SET GLADWIN RE-MON FROM FOUND IRON & WITNESSES. 1980 MEAS. BY PAUL LAPHAM AGREES WITH 1907 MEAS. BY KNOX.

SEE DOSSIER FOR DETAILED REPORT.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


G-10: 1/4 CORNER COMMON TO SECTIONS 27 & 28  
SET 5/8" X 36" REROD WITH GLADWIN RE-MON CAP MARKED P.S.#27458 IN MONUMENT BOX.

WITNESSES:  
N38E POWER POLE, N&T, 63.21'      N45E HOUSE NW CORNER CONC. BLOCK 124.84'  
N45W POWER POLE, N&T, 84.11'      NORTH, P.K. NAIL, 2.0'  
N85E 14" W PINE 62.85'              EAST, P.K. NAIL, 2.0'  
WEST 2" NORWAY MAPLE, CENTER, 56.10'

APPROVED LAND CORNER

DATE 15 of 1996  
Gladwin County

Co. Rep. John Meyers  
Date 11/6/96

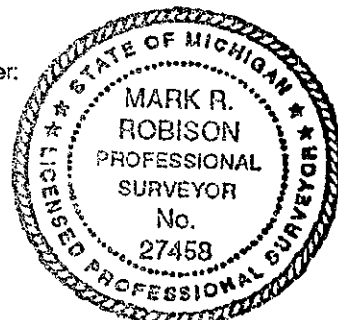

Signed by Mark R. Robison  
Surveyor's Michigan License No. 27458

Date 11-29-96