

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

GOGEBIC COUNTY

Register's Office }
Gogebic County } ss.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 45 N. X, R. 44 W.	A-7
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____	PEER GROUP Approved	
5. PRIVATE CLAIMS _____	<u>Richard L. Drahn 1/20/94</u>	

Received for record the
5TH day of JANUARY
A. D. 1994 at 10:05 o'clock
9 m., and recorded in
Liber 4 of CORNERS
on page 348.
Betty Saari Deputy
Register of Deeds

REGISTER OF DEEDS STAMP AND
FILING NUMBER

Section corner 18, 19, 13 and 24; T.45N., R.44-45W.

I, Richard L. Drahn do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on May 26 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Austin Burt, U.S. Deputy Surveyor, on August 28, 1847.
Original bearing trees:

Y. Birch	14"	S.47°E.	25 links	(16.50 feet)
Y. Birch	12"	N.36°W.	26 links	(17.16 feet)
Sugar	12"	S.48°W.	40 links	(26.40 feet)
Cedar	10"	N.69°E.	57 links	(37.62 feet)

No record of subsequent corner restoration found.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Area heavily disturbed by logging activities. No evidence of original or subsequent corner restoration found. Corner position re-established by proportionate measure on line between the section corner of 6, 7, 1 and 12, and the Closing Corner of Sections 19 and 24 on the Michigan-Wisconsin State Line.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a standard 2 1/2" diameter by 30" long split base aluminum monument with a 3" cast aluminum cap, stamped to read: T.45N., R.44-45W.; S-18, S-19, S-13, S-24; 1993; R.L.S. 21564. From which I have established the following new blazed and scribed bearing trees:

7"	Red Maple	N.13°E.	16.98 feet
7"	Sugar Maple	S.31°W.	26.04 feet
7"	Sugar Maple	N.84°W.	20.80 feet
6'	Steel rail	S.34°E.	1.87 feet

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Richard L. Drahn DATE December 27, 1993

MICHIGAN REGISTERED LAND SURVEYOR

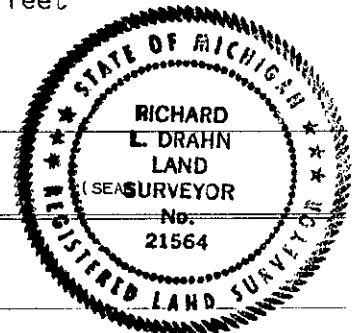

(SEAL)

FED N-1

SURVEYOR'S MICHIGAN REGISTRATION NO. 21564