	HER RECORDATION CERTIFICATE irement of Act 74, Mich. P.A. 1970	Register's Office ss.
ated In:	Corner Code #	Received for record the  26711 day of MAY  A. D. 38 00 at 10:50 o'clock
16 N R <u>44 W.</u> R	G-8	
RR	SURVEY & EMONUMENTATION	Therefore Register of Maria

	riing Re	quitement of Act 14, wich. F.A. 191	D to I for many the
For corners in  Gogebic (County)	Located In:	Corner Code #	Received for record the 2671 day of MAY  A. D. \$\frac{48}{2} \cdot 00 \text{ at } 10:50 \text{ o'clock}
1. Public Land Survey	T46 N R44 W. T R T R	G-8 SURVEY &	A m., and recorded in Liber 7 of Convers
<ol> <li>Property Controlling in Section</li> <li>Miscellaneous Property in Sec.</li> </ol>	STRSTRSTR	SECTION	Register of Deeds Stamp & File Number
that under requirements of P lines 1 and 2 above were in a the current manual of survey Bureau of Land Management points mentioned in lines 3 Michigan Board of Land S re-established, monumented,	in a field survey on Mey .A. 74, Michigan P.A. of 19 conformance with regulation y instructions of the United at or by a decree of a Cou y 4 and 5 above were in courveyors or by a Decree	do hereby state 170, the corner points mentioned in 170, the corner points mentioned in 170, the corner for the Interior, 171 of Law and /or that the corner conformance with the rules of the 171 of a Court of Law; established, 181 seed below:	A B C D E F G H I J K L 7  2 -6 - 5 - 4 - 3 - 2 - 1 - 3  4 - 7 - 8 - 9 - 10 - 11 - 12 - 5  6 - 18 - 17 - 16 - 15 - 14 - 13 - 7  8 - 19 - 20 - 21 - 22 - 23 - 24 - 9  10 - 30 - 29 - 28 - 27 - 26 - 25 - 11  12 - 31 - 32 - 33 - 34 - 35 - 36 - 13

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by Austin Burt on 8/14/1851. Original bearing trees:

Cedar Fir

12" 10"

S.76° E. N.64° W.

11 links

(7.26)

45 links (29.70')

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Corner research on file with Gogebic County records.


Restored corner position at record bearing and distance from the remains of the original Cedar B.T.. It is now a badly decayed 16-20" downed Cedar with portions of the original blaze overgrowth still visible. No evidence remains of the original Fir bearing tree. The 11.06 chain distance south to " stream 6 links, NE" checks to within four feet.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a 3/4" X 4' aluminum rod monument with a 3 1/4" stamped aluminum cap and the Following new B.T.s (all measurements taken to a nail in side of tree)

S.11° W. Black Ash 10.691 N.33° W. 9" Black Ash 28.75 9" Black Ash N.76° E. 25.13 Steel sign rail S.81° W. 2.38



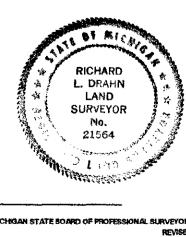

FORM APPROVED BY INICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

21564 Surveyor's Michigan License No.\_\_\_

\_\_ Date \_\_<u>May 17, 2000</u>

REVISED MAY 14,1975 REVISED JAN., 1983

REVISED OCT., 1995

USFS P-13