DEC 1 5 1998

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Register's Office Cogebic County	
Cogebic tounty	83.

For	r corners SECTION		Filing Requirement of Act 74, Mich. I			
_G	ogebic (County)		Locate	d In:	Corner Code ##	
1.	Public Land Survey		<u>T46</u>	N R 45W	A-5	
			т т <u>46</u>	R N_R_46W	M-5	
2.	Property Controlling in Section	S S		R		
3.	Miscellaneous Property in Sec	s s	T	R R		

Received for record the

25 day of November

A. D. 1998 at 10:00 o'clock

A. m., and recorded in

Liber 7 of Corners

Register of Deeds

Register of Deeds Stamp & File Number


4. Lot No. ______, Recorded Plat _______

5. Private Claims _____

Section Corner 7, 18, 12 & 13; T.46 N., R.45-46 W.

I. Richard T. Drahn in a field survey on November 1, 19 98 ... do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

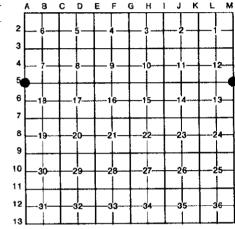

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by John Burt on 9/1/1847. Original B.T.s --- Hemlock 10" S.54 E. 13 links (8.58') --- Cedar 8" N.50 W. 18 links (11.88') --- Hemlock 10" S.02 W. 22 links (14.52') --- Elm 22" N.10 E. 14 links (9.24')

R. Burke & J. Peryam, timber cruisers, recovered this location in Feb.1955. They reported a downed 12" scribed Cedar, a wood post and a 12" squared Cedar "register" tree.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Restored corner position at record bearing and distance from the original Cedar and Elm B.T.s. No evidence remains of the two Hemlock B.T.s. The Cedar B.T. is now a very badly decayed 10-16" downed Cedar. The Elm B.T. is now a 30-40" decayed Elm windfall.

Post recovered in 1955 is now a 4" squared X 5' long Cedar post in a mound of large stones. The Cedar "register" tree is now a 14" downed Cedar with very old blazes bearing S.30 W. 11.5'. Post bears S.03 W. 11.5'.

Corner research on file with Gogebic County records.

Richard K. Wydm 11/24/98

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner. At the corner I set a $2\frac{1}{2}$ " X 30" aluminum monument with a $3\frac{1}{4}$ " stamped aluminum cap and the following new B.T.s

6"	Sugar Maple	N.78 E.	8.36'
11"	Sugar Maple	N.35 W.	20.01'
7"	Sugar Maple	s.42 W.	39.66'
6 '	Steel sign rail	N.16 E.	2.17'

RICHARD
L. DRAHN
LAND
SURVEYOR
No.
21564

Signed by Richard L. Wrahm.
Surveyor's Michigan License No. 21564

___Date <u>November 9, 1996</u>

86