SUTIVEY & REMONUMENTATION

NOV 1 2 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Register's Office ss.
Received for record the
A. D. 19 97 at 10:50 o'clock
m., and recorded in

Liber 6 OF COLNERS Page 220 Ramona Collins Deputy Kegister of Deces

Register of Deeds Stamp & File Number


FO	r corners in		
Gogebic (County)		Located In:	Corner Code ##
1.	Public Land Survey	T 46N R 46W	
		TR	
		т <u>45N</u> R <u>46W</u>	C-1
2.	Property Controlling	S T R	
	in Section	S T R	
3.	Miscellaneous	S T R	
	Property in Sec.	S T R	

5. Private Claims _ Section Corner 5, 6, 31 & 32; T.45-46 N., R.46 W. 1988

__ , Recorded Plat .

I. Richard L. Drahnin a field survey on October 2, 19 97 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

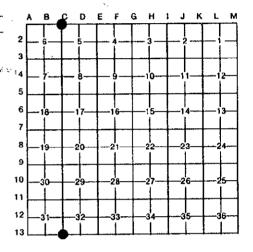

A. Description of original monument and accessories and/or subsequent restoration:

Corner established by John Burt on August 31, 1847. Original B.T.s ---Cedar 12" N.70 E. 34 links (22.44') --- Sugar 16" N.19 W. 8 links (5.28') --- Hemlock 18" S.60 W. 64 links (42.24') --- Y. Birch 22" S.72 E. 12 links (7.92') ---

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Restored corner position at record bearing and distance from the remains of the last three bearing trees. The Sugar is now a large windthrown stump hole and the Hemlock and Y. Birch are now badly decayed stumps. The 27.10 chain distance west to the recovered C.C. of sec"s 31 & 6 and the 7.93 chain distance south to the recovered C.C. of sec's 5 & 6 are in accordance with the field notes of the original Government survey. No evidence remains from the original Cedar B.T.

Research form on file with Gogebic County records.

COUNTY

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a 2" X 30" aluminum pipe with a $3\frac{1}{4}$ " aluminum cap stamped to indicate the corner position and the following new B.T. DI AICH

S.12 E. 15.08 Sugar Maple N. Red Oak S.70 W. 26.24 11" N.16 E. 14.28 7" Sugar Maple

N.13 W. Steel sign rail 2.31' 6 '

Surveyor's Michigan License No. __21564

____ Date <u>October 6, 1997</u>

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983

RICHARD

L. DRAHN LAND

SURVEYOR Nο

21564

LAND