

JAN 20 2000

GRATIOT COUNTY REMONUMENTATION PROGRAM

LIBER 619 PAGE 922

LAND CORNER RECORDATION CERTIFICATE

STATE OF MICHIGAN
GRATIOT COUNTY
RECORDED

SECTION

Filing Requirement of Act 74, Mich. P.A. 1970

11 JAN 2000 9:34 A.M.

JANET K. DAVIS
REGISTER OF DEEDS

For corners in:

Gratiot County	Located In:	Corner Code #
	Arcada Township	
1. Public Land Survey	Sec. 2,3 T 11N R 03W	I-03
	10,11 T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

I, William G. Tingley, in a field survey on July 22, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- June 11, 1832, H. Burnham, Deputy Surveyor, GLO notes
North between Secs. 10 & 11 80.00 chains, set post corner, Secs. 2, 3, 10, & 11
W. maple 8" S72°E 17 links
Tam. 12" N72°W 57 links
- 1866-1892, S.S. Hastings, and 1895, D.W. Altenburg, Record of Minutes of Survey, Liber, Page 2.
Post under causeway
Cedar Pole 14" N19-1/2 W87-1/2
Cedar Pole 10" S58-1/2 E84-2/3
SE Corner Bridge Wall 0.25-1/2 chains
South End of Bridge W. about 19 links
- July 17th, 1974, David B. Whitter, Registration #10070, L.C.R.C., Liber 1, Page 217
Found 1-1/2" Iron Pipe
Nail NW Side P. Pole N45°E 33.30'
Nail N Side P. Pole West 31.94'
- July 23, 1975, Donald E. Hunter # 19177, Survey # G-1906, Liber 399-Page 1200
Found corner, no witnesses listed
- November 30, 1978, Jerry L. Jones # 19838, Survey G-3263, Liber 418-Page 52
Found corner, no witnesses listed
- November 22nd, 1983, Duane Wood, Registration #24625, Certificate of Survey # 83101
1-1/2" Iron Pipe
Nail NW Side P. Pole N45°E 33.30'
Nail N Side P. Pole West 31.94'
- June 28, 1993, William G. Tingley #30104 Survey # 93224
Found corner, no witnesses listed

ACCEPTED BY THE GRATIOT COUNTY SURVEY GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD 1/30/99

WGT
William Tingley, PS, Chairman

(Continued on back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Searched at apparent location of corner and found 1 1/2 iron pipe 0.10' below gravel surface over 1" iron pipe 0.85' below gravel surface. Also found large rocks at 1.0' below gravel surface and 2.60' below surface around the iron pipes. Excavated a hole 2.00' in diameter and 2.60' deep, did not dig past the second layer of rocks

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set standard remonumentation pipe over both iron pipes.

	(M) measured	(R) Recorded		
Found nail and tag (unreadable) Southside PP	(M) N78°W	(R) N80°W	(M) 31.87'	(R) 31.86'
Found nail and tag (unreadable) SE side PP	N60°E	N60°E	33.22'	33.18'
Found nail and tag (unreadable) NW side light pole	S59°W	S50°W	62.14'	62.10'
Set nail and tag #30104 SW side PP	S10°E		129.64'	

Signed by William G. Tingley
Surveyor's Michigan License No. 30104

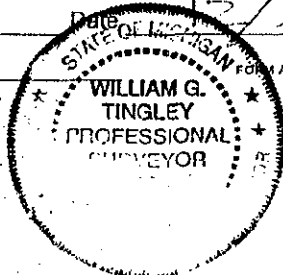

APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993

LIBER 619 PAGE 922

Continued from front

- 8. July 29th, 1993, David E. Erickson, Registration #29245, Certificate of Survey, Liber 525, Page 925.

1-1/2" Iron Pipe

N&T in S. Side of P. Pole	N60°E	33.18'
N&T in S. Side of P. Pole	N80°W	31.86'
N&T in W. Side of 8" Maple	N30°W	46.40'
N&T in N. Side of Light Pole	S50°W	62.10'

- 8. January 24, 1996, William G. Tingley, # 30104, Survey # 96025
Found corner, no witnesses listed

- 10. February 5th, 1998, Jan S. Fokens, # 21567, Certificate of Survey, Liber 580, Page 505.

1-1/2' Iron Pipe

Nail P.P.	N66°E	33.20'
Nail Drop Pole	S56°W	31.85'
Nail Service Pole	West	62.10'
N&T 18" Elm	N30°W	46.12'

RECORDS SECTION

JAN 20 2000

SECTION