LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970


Grand Traverse		Located In			Corner Code #	
(County)						
1. Public Land Survey		T T	27N 27N	R R	9W 10W	A-5 M-5
Property Controlling in Section	s	Т		R		
	S	Т		R		·
Miscellaneous Property in Section	s	T		R		
	°—	,		R		
4. Lot No:	Recorde	d Pl	at:	_		
5. Private Claims:	4.4.4					

For Corners In:

1, <u>Craig W. McVean</u>, in a field survey on <u>Nov. 29</u>, 19<u>99</u> do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law;

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

established, re-established, monumented, recovered, found as expressed below:

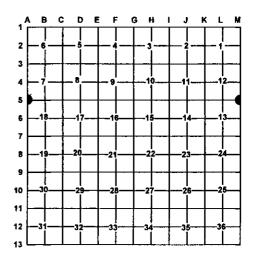

Register of Deeds Stamp & File Number

- A. Description of original monument and accessories and/or subsequent restoration:
- A-5&M-5-GLO- set post corner sec. 12&13, T27N, R10W J.Hodgson–1839 Pine 6" N58W 12 L., Pine 6" S14W18 L. GLO- L. Lyon 1850- Resurveyed T27N, R9W. West intersect
 - range line 1.87 S. of corner and 74 L. West. The corner appears to have been established East of the Range line . Established new Y. Pine 18" S28°E 31 links corner. Maple 10" N44°E 6 links,
 - -GLO- O. Risdon 1852 Resurveyed T27N, R10W. East-intersect East boundary 64 links S. of old corner & 1.24 Ch. N. of corner set by Mr. Lyon in 1850, took new bearings at Lyon's corner. Blk. Oak 14" N66°W 60 L., Y. Pine 18" S63° W 43 L.
 - -L.1, pg. 74-75 C.P. Tuller- 1889 sec. 13, T27N, R10W survey. Found corner.
 - L.1, pg. 519 & 521; L.10 pg. 23 & 132 E.P. Waterman –1915 & 1916 sec. 7, T27N, R9W survey. SW. cor. of 7 old Pine stake & iron found here old stake hole & rotten stake in the ground & remains of both US wit. Made new; Pine stp. 14" S18"W 13.5', Pine stp. 16" N38°E 51.1'. A jog here of 1.87 CH's or 123.24' as shown on plat

- -L.3, pg. 308 E.P. Waterman -- 1917 Sec. 13- T27N, R10W survey
- drove new oak stake 123.42' N of iron at SW. cor. of sec. 7 K.J. Ostling –1966- DNR sur. sec. 12 T27N, R10W found % " sq iron bar, one USBT. stp.
- LCRC L.2, pg.297 C.F. Roser- 1977- Fnd 1" sq. iron as recovered in previous Dept. sur. for corner common to sec. 7 & 18 (27-9) & sec. 12&13 (27-10) at old cor. fence post, fence remains N&E .

 Recovered iron fits E.P. Waterman's survey of sec. 7 (27-9). Corner also fits remains of USBT. (Y. Pine SE.) . Note survey by Waterman sec. 7 (27-9) & sec. 13 (27-10) indicate a jog of 123.42' N. for corner to sec. 12&13 (27-10). We found shadows of oak stake at 123' N. of found 1" sq. iron but no occupancy to E or W . Orange Risdon in gov't resurveyed of line between sec. 12&13 (1852-27-10) is very explicit in accepting corner common to sec. 7&18 (27-9) by L. Lyon in 1850. This surveyor therefore did not accept Watermans corner to sec. 12&13 but did accept Waterman's perpetuation of sec. cor. to sec. 7&18 (27-9) (found 1" sq iron) and also accepted this same iron as corner common to sec. 12&13 (27-10) per gov't . resurvey dated 1850 & 1852. This fits on the ground also. 20" Twin Oak N4°W 63.4', 6" White Pine N53°W 49.4', 14" Oak S76°E 32.2', Old Yellow Pine stump S28°E 20.5' 8" W. Pine N74"W 32.2'
- B. Description of corner evidence found and/or method applies in restoring or re-establishing corner:
- A-5 & M-5 Standard Corner common to Sec. 7 & 18, T27N, R9W & Sec. 12 & 13, T27N, R10W Found 1" X 4.5' long solid iron rod with sq. head noted by Roser LCRC. By reading the GLO resurvey notes it shows that Lyon in 1850 set at new corner 1.87' S. & 74 L. W. of Hodgson's apparent 1839 post. Risdon's 1852 resurvey of T27N , R10W notes that he used Lyon's corner in his resurvey. Thus Hodgson's post in 1839 was not utilized in the resurveys of T27N, R9-10W and the jog used by Waterman's survey's of 123.42' between A-5 & M-5 is incorrect. The corner is common to both Townships. The found 1" iron rod with sq. head is verified as Lyon's corner by his SE. pine wit. stp. with hack in place. Using corner as common also fits Tuller's survey distance S. for sec.12. We measure grid distance of 2624.01 to A6 - M6 vs. 2628.12' - Tuller. Found 1" iron rod with sq. head accepted as a careful & faithful perpetuation of position of the original corner
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-5 & M-5	- Drove 1" X 4.5' long solid iron Rod with sq. head down.	Placed 3 1/4 " 'Gr	rand Traverse Co.	Remon. ' Bra	ss cap on 2½ "	X 30'
	galvanized iron pipe over the top of 1" iron rod.					

S78°E 32.86' to set nail and tag in N. side 18" Red Oak (CFR) \$24°E 21.31' to set nail and tag in face of hack in core of 12" +/- Y. Pine stp. (GLO) N. side 14" N74°W 32.57' to set nail and tag in White Pine (CFR) 21" N6°W 63.78 to set nail and tag in E. side Twin Red Oak (CFR) to set nail and tag in NE. side 12" White Pine N55°W 49.39' (CFR) to set nail and tag in SE. side 16" Red Pine scribed 'XBT' S63°W 52.00'

Signed by:	Cruy	W.	Millen	
Surveyor's M	lichigan License	No.:	39088	

