

SEP 17 1999

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

SECTION

333

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 47N N. S., R. 36W E. W.	A3
2. PROPERTY CONTROLLING IN SECTION	T. 41W N. S., R. 37W E. W.	M3
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S., R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTERED OFFICE } 33.
 Houghton Co.
 R. 11/13/96
 of Oct 10
 of Land Corner Records
 FOR RECORD ON 21st day
 A D 1996... at 8:46
 M. recorded in Vol. 3
 Page 333
 SR. Register

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on May 15, 1996, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Section corner common to Sec's. 1 & 12 of T47N R37W and Sec's. 6 and 7 of T47N R36W

- 1846 survey by John Burt Set Wood Post, (1) W.Pine 10 S45E 7 links, (2) W.Pine 12 N55W 7 links
- 1851 survey by E.C. Martin Fd. Wood Post, (3) W.Pine 14 N30E 23 links
- 1973 survey by Don Lappala #12585 Liber 1 Page 309 Fd. a 1.5"x36" I.P. and witness 1, Set 2"x60" I.P. filled with concrete with a brass cap, (4) Aspen 6 S82E 29.5 ft., (5) Aspen 10 S15E 13.8 ft., (6) Tele. Pole N23E 42.9 ft., (7) Metal Sign Post N10E 1.9 ft.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the 2"x60" galvanized iron pipe filled with concrete w/ brass cap by Lappala, 50 feet Southeast of the centerline of the abandoned Railroad to be leaning about 20 degrees out of plumb. I checked into witnesses 4 through 7 and straightened the monument. Witnesses 1 and 2 are gone. Witness 3 is under thick ice. Witnesses 4 through 6 have been cut down. Witness 7 is leaning badly. Liber 1 Page 309 by Lappala documents the history of this corner. The GLO calls confirm this corner is in the proper location. This monument is accepted as a faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Section corner common to Sec's. 1 & 12 of T47N R37W and Sec's. 6 and 7 of T47N R36W Monu. The 2"x60" galvanized iron pipe filled with concrete with 3" brass disk was left in place.

- Witnesses:
- 60d in the northwest side of a W.Spruce 4 N32E 33.22 feet
 - 60d in the east side of a W.Spruce 5 S9E 140.66 feet
 - 60d in the east side of a W.Spruce 8 S59E 204.04 feet
 - 60d in the southwest side of a W.Spruce 8 N78W 35.85 feet
 - Metal Sign Post N10E 1.65 feet (7)

APPROVED LAND CORNER
 P.A. 345 OF 1990
 Houghton County

Nov. 13, 1996
 Robert W. Campbell


SIGNED BY Patrick R. Leemon DATE May 15, 1996

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
 CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
 MICHIGAN REGISTERED LAND SURVEYOR

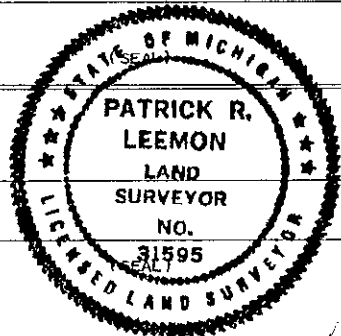

SURVEYOR'S MICHIGAN REGISTRATION NO. _____