

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Houghton</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>51N</u> R <u>35W</u>	<u>EB</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u>21</u> T <u>51N</u> R <u>35W</u>	<u>10</u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Oct 21 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:
 (E8) Quarter corner common to Sections 20-21. Reestablished in 1974 by A.O. Enger, RLS, on line between Sec. Cor. 40.026 ch. to N and to S. 1" ID x 36" iron pipe with 3.5" aluminum cap. Sugar Maple 7 N40W 21.3', Sugar Maple 8 N73E 19.9', Y. Birch 9 S05W 10.1'. Found no subsequent record.
 (10-Sec. 21) South 1/16 corner between Sections 20-21. Corner established in 1974 by A.O. Enger, RLS: Established on line between Sec. Cor. 40.013 ch. S and 1/4 cor. 40.013 ch. N. 1"IDx36" iron pipe with 3.5" aluminum cap. Sugar Maple 15 S61E 14.4', Red Maple 11 N18E 20.8'. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E8) Recovered the 1974 monument as described, in good condition, and at record bearing and distance from the 1974 accessories. The Y. Birch is a dead standing stub with scribing and notch plain, the Sugar NE is in good condition, the Sugar NW is dead. Left the monument in place and marked three new accessories as described below.
 (10-Sec.21) Recovered the 1974 monument as described, in good condition, and at record bearing and distance from the 1974 accessories, now both stump remains with lower blaze, notch, and scribing plain. Left the monument in place and marked four new bearing trees as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

(E8) Found 1" pipe with 3.5" aluminum State of Michigan cap. Blazed and scribed the following:
 10" Y. Birch S46E 32.5' "1/4S NBT"
 5" Y. Birch S19W 7.2' do
 10" Y. Birch N71W 12.9' do
 Bearings are magnetic. Distances are horizontal and to notch in lower blaze.

(10) Found 1" pipe with 3.5" aluminum State of Michigan cap. Blazed and scribed the following:
 12" Hemlock N43E 20.0' "1/16S BT"
 7" Y. Birch S01W 2.0' do
 5" Y. Birch S74W 10.2' do
 12" Y. Birch N10W 16.3' do
 Bearings are magnetic. Distances are horizontal and to notch in lower blaze.

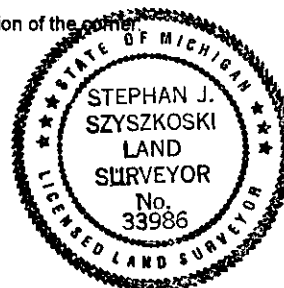

Signed by Stephan J. Szyszkoski Date 0/26/99
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division