

62

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Houghton</u>	Located In:	Corner Code #
(County)		
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>15</u> T <u>51W</u> R <u>35W</u>	<u>4</u>
	S <u>15</u> T <u>51W</u> R <u>35W</u>	<u>8</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Aug 04 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

(4-Section 15) Northwest 1/16 corner, Section 15. Corner not established in the original survey. Found no subsequent record.

(8-Sec. 15) West 1/16 corner, Section 15. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(4-Section 15) found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners, only those to the South and East being monumented at this time. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.

(8-Sec. 15) found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between Quarter corner 1324.00' West and Center of Section 1324.00' East. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(4) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

16" Sugar S03W 23.0' "NW1/16 BT"

6" B. Ash N54W 4.6' "NW1/16 BT"

8" Ironwood N14E 19.3' "NW1/16 BT"

8" Sugar S79E 11.4' "NW1/16 BT"

Placed squared post adjacent. Bearings are magnetic. Dist. to notch in lower blaze.

(8) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:


6" Sugar N25W 27.3'

6" Maple N03W 26.2'

18" Y. Birch S66E 44.9'

Twin 8" Y. Birch S33W 11.2'

Monument leans slightly east. Top Center is the mark. Bearings are magnetic. Dist. to notch in lower blaze.

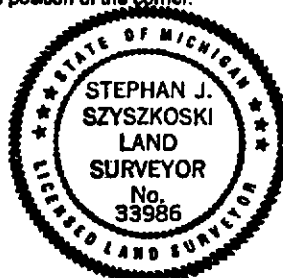

Signed by

Stephan J. Szyszkoski

Date

2/9/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division