## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Houghton Comer Code # Located in: 1. Public Land Survey 2. Property Controlling in Section 3. Miscellaneous

Register of Deeds Stamp & File Number


4. Lot No. Recorded Plat 5. Private Claims

Property in Sec.

14 Aug 04 1997 12 Jul 10 1997

Stephan J. Szyszkoski \_, in a field survey on requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current menual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and Jor that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

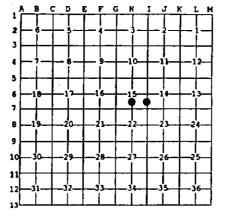

A. Description of original monument and accessories and/or subsequent restoration:

(12-Sec. 15) South 1/16 corner, Section 15. Corner not established in the original survey. Found no subsequent record.

(14-Sec. 15) South 1/16 between Sections 15-14. Corner not established in the original survey. Found no subsequent record.

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(12-Sec. 15) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between Quarter corner 1304.38' south and Center of Section 1304.38' north. At the position for the corner, I placed a 1' I.O. x 32' iron pipe capped with a 4" dia. cast aluminum HONR tablet, appropriately stamped. Corner placed and mitnessed by D.Lampela and B.Wheeler, Baraga District Office.

(14-Sec. 15) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Quarter corner 1329.03' north and Section corner 1329.03' south. At the position for the corner, I placed a 1' I.D. x32 from pipe, capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by 8.Wheeler and D.Lampela, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

(12) Set 1 pipe with 4 MONR cap.

(14) Set 1 pipe with 4 MONR cap.

Blazed and scribed the following bearing trees:

Blazed and scribed the following:

1/165 BT 6" Y. Birch S02W 22.3' 5" Sugar N43W 29.5" "1/16S 8T" 7" Sugar \$86E 36.4" "1/16S BT"

9" Sugar N86W 36.2' 1/16S BT Placed a squared post adjacent.

Bearings are magnetic. Dist. to notch in lower blaze.

STEPHAN J SZYSZKOSKI LAND SURVEYOR

3398G

"1/16S BT"

"1/16S BT"

"1/16S BT"

"1/165 BT"

Surveyor's Michigan License No.

Bearings are magnetic. Dist. to notch in lower blaze. Placed a squared sugar

14" Sugar N38W 24.8'

16" Hemlock \$23E 22.6

5" Sugar N66E 9.3"

6" Sugar \$84N 11.4"

post adjacent.

For the Michigan Department of Hatural Resources - Forest Management Division