

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton
 (County)

Located In:

Corner Code #

- | | | | |
|------------------------------------|-------------|--------------|-----------------------------|
| 1. Public Land Survey | T | R | _____ |
| | T | R | _____ |
| | T | R | _____ |
| | T | R | _____ |
| 2. Property Controlling in Section | S <u>14</u> | T <u>51N</u> | R <u>36W</u> _____
_____ |
| 3. Miscellaneous Property in Sec. | S <u>14</u> | T <u>51N</u> | R <u>36W</u> _____
_____ |
| | S _____ | T _____ | R _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

13 Apr 06 2000
 12 Apr 05 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


- (12-Sec. 14) South 1/16 corner, Section 14. Corner not established in the original survey. Found no subsequent record.
 (13-Sec. 14) Southeast 1/16 corner, Section 14. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (12-Sec. 14) Established the corner midway and on a straight line between Center of Section 1310.36' north and Quarter corner 1310.36' south. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.
 (13-Sec. 14) Established the corner at the intersection of straight lines connecting opposite 1/16 corners. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| (12) Set 1" pipe with 4" MDNR cap.
Blazed and scribed the following:
11" Y. Birch N41W 33.0' "1/16S BT"
8" Y. Birch N18E 27.6' do
5" Sugar S66E 15.3' do
13" Sugar S09E 22.2' do
Placed squared Sugar post adjacent.
Bearings are magnetic. Distances are to notch in lower blaze. | (13) Set 1" pipe with 4" MDNR cap.
Blazed and scribed the following:
15" Sugar N01E 20.1' "1/16S BT"
8" Y. Birch S59E 49.8' do
6" Maple S29W 37.3' do
4" Sugar S75W 48.2' do
Placed squared Sugar post adjacent.
Bearings are magnetic. Distances are to notch in lower blaze. |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|

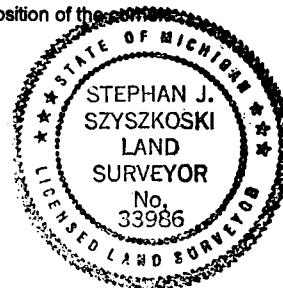

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 5/1/00

For the Michigan Department of Natural Resources - Forest Management Division