

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Houghton</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>13</u> T <u>51N</u> R <u>36W</u>	<u>11</u>
	S <u>13</u> T <u>51N</u> R <u>36W</u>	<u>8</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Apr 10 2000

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


(11-Sec. 13) Southwest 1/16 corner, Section 13. Corner not established in the original survey. Found no subsequent record.  
 (8-Sec. 13) West 1/16 corner, Section 13. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(11-Sec. 13) Established the corner at the intersection of straight lines connecting opposite 1/16 corners. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the position monumented, I found a 1 1/4" dia. iron pipe S57W, 11.52' distant, not of record.  
 (8-Sec. 13) Established the corner midway and on a straight line between Quarter corner 1324.84' west and Center of Section 1324.84' east. At the position for the corner I placed a 1" IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. From the position monumented, I found a 1 1/4" ID iron pipe S07E 12.05' distant, not of record.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(11) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 16" Sugar N75E 28.25'    "1/16S BT" 9" Sugar S42E 31.45'    do 8" Y. Birch S66W 47.50'    do 15" Sugar S74W 19.55'    do Fd. 1.25" ID pipe S57W 11.52' Placed squared Sugar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.	(8) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following: 6" Sugar N65W 5.1'    "1/16S BT" 8" Y. Birch N87E 10.0'    do 9" Y. Birch S54E 26.2'    do 7" Y. Birch S53W 7.6'    do Fd. 1.25" ID iron pipe S07E 12.05' Bearings are magnetic. Distances are to notch in lower blaze.
---	--

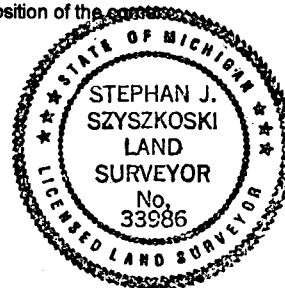

Signed by Stephan J. Szyszkoski Date 5/1/00  
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division