

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Houghton</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>51N</u> R <u>36W</u>	<u>L5</u>
	T <u>51N</u> R <u>36W</u>	<u>M5</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Mar 14 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 (L5) Quarter corner common to Sections 12-13. Reestablished in 1970 and recorded in 1972 by A.O. Enger, RLS. 1" ID x 36" iron pipe with 4" aluminum cap. Sugar Maple 13 N52W 25.1', Hemlock 13 S51E 11.3'.
 (M5) Corner common to Sections 12-13 T51N-R36W and 7-18 T51N-R35W. Corner reestablished in 1962 and recorded in 1963 by Billy D. Buckler, RLS. 1" iron pipe with 4" aluminum cap. 10" H. Maple S62E 40 links, 6" Y. Birch N82W 15.5 links.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (L5) Recovered the 1970 monument, as described, but with only the stem of the aluminum cap in place. The tablet has been broken off. The monument was found at record bearing and distance from the remaining NBT Hemlock, in good condition with blazes overgrown. Position of the monument checks well with Enger's measurements around Sections 13 and 14. Made the monument firm and made new witnesses as described below.
 (M5) Recovered the 1962 monument as described, a 1" ID iron pipe capped with a 4" dia. Michigan Dept. of Conservation tablet, appropriately stamped, in good condition, at record bearing and distance from the remaining NBT H. Maple, found in good condition with overgrown blazes. Left the monument in place and made new witnesses as described below. The corner falls on the south edge of a power line clearing.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (L5) Found 1" pipe with stem of aluminum cap. The 1970 wit:
 16" Hemlock S46E 11.3' overgrown blz
 Set PK nail/washer in NW face power pole No. 101. N46E 60.1' (slope dist).
 Blazed and scribed the following:
 7" Y. Birch S02W 5.4' "1/4S NBT"
 8" Y. Birch S70W 21.0' do
 Bearings are magnetic. Distances are to notch in lower blaze.
 (M5) Found 1" pipe with 4" alum. cap. The 1962 wit:
 16" Sugar S62E 25.9' w/overgrown blz.
 PK/washer in W. face Power pole No. 97 North 42.5'
 Blazed and scribed the following:
 10" Sugar S18W 26.5' "S13 NBT"
 18" Y. Birch S77W 26.2' do
 Bearings are magnetic. Distances are to notch in lower blaze. A squared 18" hemlock is 1 ft. NE'ly.

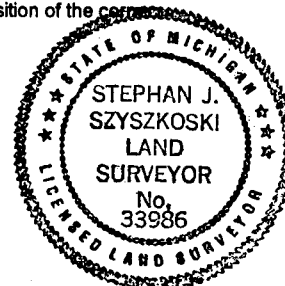

Signed by Stephan J. Szyszkoski Date 5/1/00
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division