

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Houghton</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>24</u> T <u>52N</u> R <u>35W</u>	<u>15</u>
	S <u>24</u> T <u>52N</u> R <u>35W</u>	<u>10</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Sep 28 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:
 (15-Sec. 24) West 1/16 between Sections 24-25. Established in 1972 by A.O.Enger RLS, midway and on line between Section and Quarter corners. 1" ID x 36" iron pipe with 4" aluminum cap. W.Spruce 6 N78W 11.4', W.Spruce 4 N50E 30.9'.
 (10-Sec. 24) South 1/16 corner between Sections 23-24. Established in 1972 by A.O.Enger RLS, midway and on line between Section and Quarter corners. 1" ID x 36" iron pipe with 4" aluminum cap. Balsam 10 S10W 24.2', B.Spruce 6 N34W 7.9'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (15-Sec. 24) Found the 1972 monument, in good condition, and at record bearing and distance from the 1972 witnesses, both in good condition. Accepted the monument as a careful and faithful determination of the position of the corner.
 (10-Sec. 24) Found the 1972 monument in good condition, and at record bearing and distance from the 1972 witnesses. The Balsam is now dead and down. Accepted the monument as a careful and faithful determination of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (15) Fd. 1" pipe with 4" aluminum cap. Blazed and scribed the following:
 9" Maple S39E 37.9' "1/16S BT"
 12" Spruce N23E 27.3' do
 The 1972 wits:
 7" Spruce N53E 30.7' overgrown blazes
 7" Spruce N75W 11.4' do
 Bearings are magnetic. Distances to notch in lower blaze.
 (10) Fd. 1" pipe with 4" aluminum cap. Blazed and scribed the following:
 13" Y.Birch S38E 52.6' "1/16S BT"
 13" W.Spruce S56W 54.8' do
 9" dbl Cedar S88W 45.9' do
 7" Spruce N30W 7.7' old blazes (1972 wit). Bearings are magnetic. Distances are to notch in lower blaze.

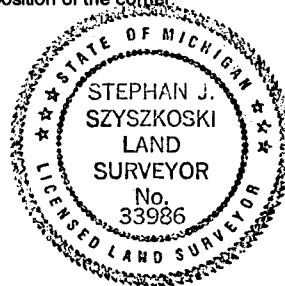

Signed by Stephan J. Szyszkoski Date 10/31/00
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division