

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u>52N</u> R <u>35W</u>	<u>J9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>24</u> T <u>52N</u> R <u>35W</u>	<u>11</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

11 Sep 19 2000
 J9 Sep 18 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9										●	●		
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


(J9) Quarter corner common to Sections 23-26. Corner perpetuated in the original position by Dean C. DeLaMater, RLS in 1953. 1" pipe with 4" brass cap. 9" Cedar N48W 24 links, 15" Cedar S8W 30 links.
 (11-Sec. 24) Southwest 1/16 corner, Section 24. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J9) Recovered the 1953 monument, in good condition, and at record bearing and distance from the 1953 witnesses, both in good condition, and at record bearing and distance from the stump remains of the original BT Cedar 12 S75E 25. Accepted the monument as a careful and faithful perpetuation of the position of the original corner.
 (11-Sec. 24) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J9) Found 1" pipe with 4" brass cap. Blazed and scribed the following: 18" Cedar S82E 29.2' "S1/4 NBT" 6" Y. Birch S70W 19.4' do The 1953 wits: 18" Cedar S14W 19.8' overgrwn blaze 15" Cedar N41W 15.8' scribing visible Bearings are magnetic. Distances to notch in lower blaze.	(11) Set 1" IDx32" IP with 4" aluminum MDNR cap. Blazed and scribed: 10" dbl R. Maple N21E 23.3' "1/16S BT" 6" Sugar N88E 25.3' do 6" Sugar S32E 39.3' do 5" W. Spruce S71W 58.2' do Bearings are magnetic. Distances to notch in lower blaze.
---	---

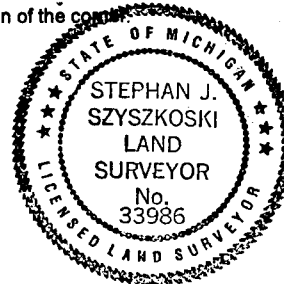

Signed by Stephan J. Szyszkoski Date 10/31/00
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division