

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Houghton</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>15</u> T <u>52N</u> R <u>35W</u>	<u>3</u>
	S <u>15</u> T <u>52N</u> R <u>35W</u>	<u>1</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Aug 26 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (3-Sec. 15) North 1/16 between Sections 15-16. Corner not established in the original survey. Found no subsequent record.
 (1-Sec. 15) West 1/16 corner between Sections 10-15. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(3-Sec. 15) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Section corner 1311.80' north and quarter corner 1311.80' south. At the position for the corner I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(1-Sec. 15) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Section corner 1154.57' west and Quarter corner 1154.57' east. At the position for the corner, which falls in a small creek, I placed a 1" ID x 32" iron pipe capped with a yellow plastic cap stamped "MICH DNR PS 33986". I also placed a WITNESS CORNER, a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, on the 1/16 line, 6.09' southerly from the corner. The witnesses below are for the WITNESS CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(3) Set 1" pipe with 4" MDNR cap. Blazed and scribed the following:
 4" Y. Birch East 27.2' 1/16S BT"
 12" Maple S01E 22.0'(slope) do
 8" Y. Birch S79W 25.7'(slope) do
 8" Sugar N07W 4.95' (slope) do
 Placed squared cedar post adjacent.
 Bearings are magnetic. Distances are to notch in lower blaze.

(1) Set 1" pipe with 4" MDNR cap for a WITNESS CORNER. Blazed and scribed the following bearing trees:
 12" Cedar N82W 35.8' "WC 8T"
 12" Hemlock N04W 40.1' do
 14" Hemlock S75E 28.25' do
 9" Y. Birch S51W 16.2' do
 Placed a squared cedar post adjacent.
 Bearings are magnetic. Distances are to notch in lower blaze.

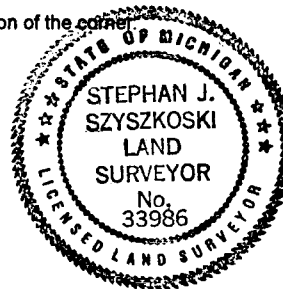

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 10/19/99

For the Michigan Department of Natural Resources - Forest Management Division