

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Houghton</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>52N</u> R <u>36W</u>	<u>K8</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S <u>23</u> T <u>52N</u> R <u>36W</u>	<u>A</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

May 19 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


(K8) Quarter corner common to Sections 23-24. Corner established in 1846 by Sylvester Higgins: "North between Section 23&24...40.00 Set 1/4 Section post. Sugar 13 S50W 17, Balsam 10 N25E 18". In book 39, pages 14-16, dated 1912 by Gibbs, Anderson, and Dan Sullivan, at the office of Hein Land Consultants in Laurium, MI, show 1/4 corner "post set No 8.T.s". S87 deg. 53'E (bearing basis not stated) 5379.0' from the NW1/4 corner of Section 23. No measurements are shown North or South to adjacent section corners.
 (8-Sec. 23) West 1/16 corner, Section 23. Corner not established in the original survey. On a survey dated Nov. 13, 1979 by Robert A. Mick, RLS 16936, recorded in Vol 1, Page 637, Houghton Co. Surveyors Map Index, a corner noted as "iron pipe set" is shown midway and on a straight line between Quarter corner 18 and Center of Section J8.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K8) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. The 1912 post was not recovered. Reestablished the corner midway and on a line of mean true bearing between Section corners 2649.47' North and South. I find the true bearing and distance west to 1/4 corner to be S87 deg. 42'24"W, 5275.84 feet. The monumented center of section 23 was found 0.7' North of a straight line between the monuments at I8 and K8. At the position for K8, I place a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.
 (8-Sec. 23) Recovered a 1/2" dia. rebar, found without a cap, 0.19' east and 0.23' south of a midpoint between I8 and J8, as now monumented. Accepted same as a careful and faithful determination of the position of the 1/16 corner. Over the top of the rebar I placed a 1" ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner recovered and witnessed by D.Lampela and B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K8) Set 1" pipe with 4" MDNR cap.	(8) Set 1" pipe with 4" MDNR cap.
Blazed and scribed the following:	Blazed and scribed the following:
6" Sugar S67W 17.05' "1/4S NBT"	4" Sugar S31W 4.0' "1/16S BT"
5" Sugar N01E 31.55' do	9" Twin Maple S51E 9.3' do
5" Sugar N39E 25.6' do	9" Maple N20E 22.85' do
8" Sugar S37E 20.95' do	10" Maple N39W 39.3' do
Placed a squared sugar post adjacent.	Bearings are magnetic. Distances are to
Bearings are magnetic. Distances are to notch in lower blaze.	notch in lower blaze.

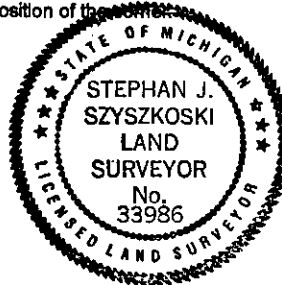

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 4-6-99

For the Michigan Department of Natural Resources - Forest Management Division