

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY &
REMONUMENTATION

DEC 14 1998

Nov. 6, 1998
Robert W. Crampton
For corners in

Houghton County	Located in:	Corner Code #
1. Public Land Survey	T53N R32W T53N R32W T R T R T R	D3 E3
2. Property Controlling in Section	S T R S T R	
3. Miscellaneous Property in Sec.	S T R S T R	
4. Lot No. , Recorded Plat		
5. Private Claims		

ROBERT F. MIKESCH 11/11/98
HOUGHTON COUNTY, REGISTER 09:42
LC 3/ 523 PAU Fee: 9.00
Page 1 of 1

SECTION

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2				
3				•	•								
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Steven C. Hein, in a field survey on September 4, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

D3: N1/4 Corner Section 8: From original notes: East between Sections 5 & 8; 40.08 Set qr. Section post; Y Birch 7 S23W 09; Do 12 N22E 10. No evidence of original corner or accessories

E3: Northeast Corner Section 8: From original notes: South between Sections 4 & 5; 80.00 Set post corner of Sections 4, 5, 8 & 9; Y. Birch 14 n58W 17; Fir 8 S79E 30. No evidence of original corner or accessories.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D3: N1/4 Corner Section 8: Found 5/8" pipe in 8" cylinder of concrete encased on sewer pipe, 7" B.G.; Corner is 7' North of North edge of gravel road surface. Corner set by W. W. Stockley around 1920. Found Witnesses; DNR tag on 12" Spruce N37°E 13.89'; nail in 8" R. Maple S22°E 62.22'

E3: Northeast Corner Section 8: Found 5/8" pipe in 8" cylinder of concrete, 2" below gravel road surface, 7' W. of CL road to North, 7' N. of CL road to West, 1.5' E. of CL road to South. Corner set by W. W. Stockley around 1920. Found Witnesses; DNR tag on Util. Pole N53°E 42.06'; Util. Pole S12°W 136.20'; Cable Marker N49°W 40.00'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D3: Set 2 1/4" Brass Cap within found pipe in concrete, secured with added conc.	E3: Set 2 1/4" Brass Cap on 3/4" pipe 10" below gravel road surface
Witnesses:	Witnesses:
12" Spruce N37°E 13.89'	Util. Pole N53°E 42.06'
8" R. Maple S22°E 62.22'	Util. Pole S64°E 22.76'
9" Cedar S42°W 67.97'	8" Balsam S26°E 58.57'
9" Balsam N55°W 25.87'	12" R. Pine N52°W 84.41'

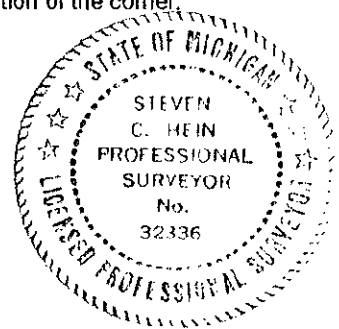

Bearings are compass bearings, corrected for declination, all distances are to a nail and tag in the side of the witness object unless otherwise noted.

Signed by Steven C. Hein

Date Oct. 31, 1998

Surveyor's Michigan License No. 32336