

JAN 22 1998

Re-Mon Liber 1 Page 120

SECTION REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN HURON COUNTY RECORDED

9 DEC 97 11:12 A.M.

FRANCES L. HOLLOWICK REGISTER OF DEEDS

Form with fields: For Corners in (Huron County), Located in: (Oliver), Corner Code # (B-13, C-13), and numbered sections 1-5.

Register of Deeds Stamp & File Number

Grid table with columns A-M and rows 2-13, containing numbers 1-36.

I, James T. Meek, in a field survey on October 30, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration: Original Survey South Bdy. T16NR11E, 1835, Harvey Parke, D.S.

B-13 South 1/4 Corner of Section 31 Post Aspen 7", N57°E, 13 links Hemlock 9", N76°W, 33 links County surveyors record: 3/8" iron Recorded surveys: L3, P45; L4, P32 LCRC: none

C-13 Corner of Sections 31 and 32 Post Hemlock 8", N34 1/2°W, 3 1/2 links Hemlock 15", N57°E, 7 links County surveyors record: iron rod Recorded surveys: none LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-13 South 1/4 Corner of Section 31 Found 1" pipe, 3" deep At intersection of Kilmanagh & Born Rds. Accepted as the best available evidence of the original corner position.


C-13 Corner of Sections 31 and 32 Found 1" pipe bent, 1" below grd. 1' North of intersection Kilmanagh & Maxwell Rds. Accepted as the best available evidence of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-13 South 1/4 Corner of Section 31 Set 1/2" iron with cap #39089, 3" below grd., over 1" iron From which: 1/2" iron flush w/grd. bears N45°E, 30.0' Tag in PP bears S45°E, 64.6' East leg of direct. sign bears S7°W, 14.8' Road sign post bears N35°W, 32.7'

C-13 Corner of Sections 31 and 32 Set 1/2" iron w/cap #39089 2" below grd. over pipe From which: 1/2" iron flush w/grd. bears N45°E, 37.0' Road sign post bears S32°E, 37.8' 1/2" iron flush w/grd. bears S45°W, 31.0' Road sign post bears N38°W, 31.5'

Signed by [Signature] Date _____ Surveyor's Michigan License No. 39089

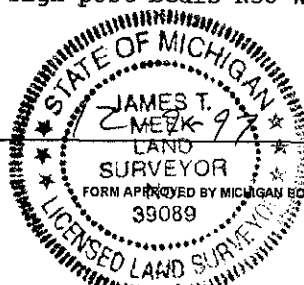

APPROVED AT PEER BOARD MEETING, Nov. 25, 1997 RLB