

SURVEY & REMONUMENTATION

JAN 22 1998

Re-Mon Liber 1 Page 119

REMONUMENTATION SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in

<u>Huron</u> (County)	Located in:	Corner Code #
1. Public Land survey	Oliver T <u>16</u> N R <u>11</u> E	<u>D-13</u> E-13
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous	S _____ T _____ R _____	_____

STATE OF MICHIGAN
HURON COUNTY
RECORDED

9 DEC 97 11:12 A.M.

FRANCES L. HOLDWICK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, James T. Meek, in a field survey on October 30, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
Original Survey South Bdy. T16NR11E, 1835, Harvey Parke, D.S.

D-13 South ¼ Corner of Section 32
Post
Maple 10", N77°E, 17 links
Pine 10", N49°W, 21 links

County surveyors record: none
Recorded surveys: none
LCRC: none

E-13 Corner of Sections 32 and 33
Post
Fir 9", N63°E, 26 links
Cedar 9", N82°W, 15 links

County surveyors record: iron rod
Recorded surveys: none
LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

D-13 South ¼ Corner of Section 32

Found ¾" iron, 1½' deep
2' North of centerline Kilmanagh Rd.
Occupation line bears North

Accepted as the best available evidence of the original corner position.

E-13 Corner of Sections 32 and 33

Found 1" pipe 3" below grd.
At intersection of Kilmanagh & Farver Rds.

Accepted as the best available evidence of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-13 South ¼ Corner of Section 32

Set ½" iron with cap #39089, 3" below grd., over 1" iron


From which:
Tag in 8" apple bears N4°W, 29.2'
½" iron flush w/grd. bears S45°E, 25.0'
½" iron flush w/grd. bears S45°W, 25.0'
Tag in 18" maple bears N62°W, 60.5'

E-13 Corner of Sections 32 and 33

Set ½" iron w/cap #39089 2" below grd. over pipe

From which:
½" iron flush w/grd. bears N45°E, 36.0'
Road sign post bears S25°E, 35.1'
Fence post bears S39°W, 33.3'
Road sign post bears N38°W, 32.5'

Signed by [Signature] Date _____
Surveyor's Michigan License No. 39089

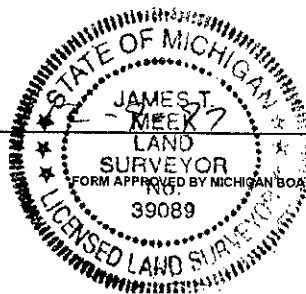

APPROVED AT PEER BOARD MEETING, Nov. 25, 1997 RLB