SURVEY & REMONUMENTATION

JAN 2 2 1998

19	March 4	4	Lincoln I	1 250	M	1
_	_	₩.		N.	TO THE	•
2 7	,	₹ .	A :		7 I V	١.

For corners in

REMONUMENTATION Re Mon Level, Page 7/ LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Huron	Located in:	Corner Code #
(County)		
1. Public Land Survey S	and BeachT <u>16N</u> TF	15E K-13 L-13
Property Controlling in Section Miscellaneous Property in Sec.	ST	2

STATE OF MICHIGAN HURON COUNTY RECORDED

6 NOV 97 10:26 A.H.


FRANCES L. HOLDWICK REGISTER OF DEEDS

Register of Deeds Stamp & File Number

f. Lot No	, Recorded Plat		
5. Private Claims			

I Charles S. Getz, in a field survey on Aug. 17, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

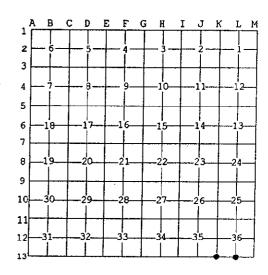

A. Description of original monument and accessories and/or subsequent restoration:

K-13 1834 G.L.O., H. Parke D.S. Set Post Set Post Hemlock 20", N44½°E,48 Links Do. 8", N74½°W, 11 Links

Co. Surveyor Records - NONE, Co. Rd. Comm. Records - Axle Survey Liber 4, Page 97 - Monument Box Huron Surveying 2-25-80 - Monument Box L.C.R.C. - NONE

L-13 G.L.O., H. Parke D.S. (1834) Set quarter section post Hemlock 12", N63°W, 14 Links Cedar 8", N41°E, 24 Links

Co. Surveyor Records - NONE, Co. Rd. Comm. Records - NONE Recorded Surveys - NONE Huron Surveying 2-25-80 - PK Nail L.C.R.C. - NONE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

SW Cor, Section 36, T16N-R15E Found 3/4" Iron Bar in Monument Box Accepted as the best available evidence of original corner position (Intersection of Helena & Schock Roads)

S 1/4 Cor, Section 36, T16N-R15E Found PK Nail as per Survey by Huron Surveying, Inc. dated 02-25-80 Accepted as the best available evidence of original corner position

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Charles S. Getz X Land Surveyor No. 25843 FORM

SW Cor, Section 36, T16N-R15E
Found 3/4" Iron Bar in Monument Box
West 78.50' to Axle Shaft in Monument Box
N45°W 72.33' to Nail in SW Side of Power Pole
S45°W 59.10' to Nail in NW Side of Power Pole
S45°E 72.05' to Nail in N. Side of Fence Post
N45°E 64.77' to SW Cor of Tele Box
West 2586.72' to S 1/4 Cor, Sec 35, T16N-R15
Fast 2640.76' to S 1/4 Cor, Sec 36, T16N-R15 West 2586.72' to S 1/4 Cor, Sec 35, T16N-R15E East 2640.76' to S 1/4 Cor, Sec 36, T16N-R15E State of Michaelle

S 1/4 Cor, Section 36, T16N-R15E
Set 1/2" Iron Bar in Monument Box (Capped)
West 47.80' to Axle Shaft in Monument Box
S35°E 71.70' to Center of 4" Well
S80°E 56.0' to Mailbox Post (Hse #9266)
S40°W 57.98' to Spike in NW Side of Power Pole
West 2640.76' to SW Cor, Sec 36, T16N-R15E
East 2625.24' to SE Cor, Sec 36, T16N-R15E

Signed by Charles S. Get Burveyor's Michigan License No._

October 12, 1997 Date

PEER GROUP APPROVED AT

BEETING NOVEMBER 5, 1997

FORM TEPPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971