

Re-Mon, Liber 1, Page 168

REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Huron</u> (County)	Located In:	Corner Code #
1. Public Land Survey	Rubicon	T17N R15E G-13
		T___ R___
		T___ R___
		T___ R___
2. Property Controlling in Section	S___	T___ R___
	S___	T___ R___
3. Miscellaneous Property in Sec.	S___	T___ R___
	S___	T___ R___

STATE OF MICHIGAN
HURON COUNTY
RECORDED

25 NOV 98 10:06 A.M.

FRANCES L. HOLDWICK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Charles S. Getz, in a field survey on Nov. 12, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

G-13	County Surveyor Records - NONE
1834 G.L.O., H. Parke D.S.	County Road Commission Records - NONE
Set Post	Recorded Surveys - NONE
Pine 24", N70½°E, 48 Links	Unrecorded Surveys - NONE
Beech 10", N79°W, 8½ Links	

L.C.R.C. - NONE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-13
SW Cor, Section 34, T17N-R15E
Found no evidence of original corner position.
Re-established corner position by using G.L.O.
offset from NW Cor, Sec 3, T16N-R15E as best
evidence of original corner position for G-13.
(Intersection of Rapson & Stafford Roads)


SURVEY &
REMONUMENTATION

JAN 28 1999

SECTION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-13
SW Cor, Section 34, T17N-R15E
Set 1/2" Re-Rod (Capped)
S10°W 32.55' to West Leg of Road Sign
S30°W 55.90' to Nail in Power Pole
N30°W 45.15' to Stop Sign
N45°E 49.90' to Telephone Box
West 216.48' to 5/8" Iron Bar
West 2636.78' to S 1/4 Cor, Sec 33, T17N-R15E
East 2630.60' to S 1/4 Cor, Sec 34, T17N-R15E

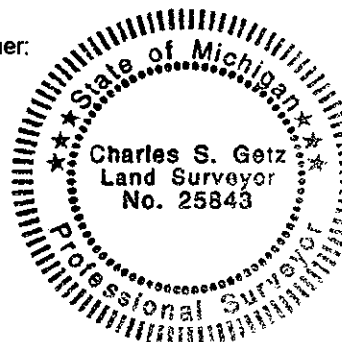

Signed by Charles S. Getz

Date November 15, 1998

Surveyor's Michigan License No. 25843

PEER GROUP APPROVED AT
MEETING 11-24-98 RRB