

1993

COMMISSION REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

88323 RECORDED HILLSDALE CO. MICH. '93 DEC 22 PM 2 20

LIBER 3 PAGE 21

For corners in Hillsdale (County) Located In: Corner Code # 1. Public Land Survey T 6S. R 3W. E-7 2. Property Controlling in Section S T R 3. Miscellaneous Property in Sec. S T R 4. Lot No. Recorded Plat 5. Private Claims

Judy Wanzandt REG. OF DEEDS

Register of Deeds Stamp & File Number

Grid table with columns A-M and rows 1-13. A circled 'X' is located at row 7, column D.

Frederick J. Cutcher in a field survey on December 22, 1993 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

From survey by R.J. Corvell, County Surveyor, dated June 23, 1889: Stone & Brick. Maple 8 N 63° E 40 1/2 links.


LCR Liber 1, Page 461, Feb. 4, 1975 by Robert E. Burris, Sr.: Dug and found nothing. Set corner on fence line to West and at proportional distances as shown in sketch (in LCR Liber 1, Page 461, Feb. 4, 1975).

Burris set R.R. Spike (LCR Liber 1, Page 461, Feb. 4, 1975).

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On this date I found a R.R. Spike 1.8' West of centerline of road and in line with fence to West.

All references remain, but are Maple trees and not Oak trees as called for.

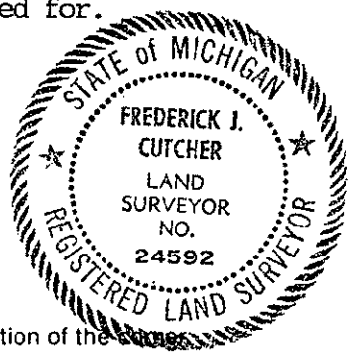

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced R.R. Spike with 3/4" x 36" steel rod with cap (County issue) in monument box. 1.8' West of centerline of road and in line with fence to West. Nail & spotter in 24" Maple N 35° E 47.67' Top center of telephone stanchion S 88° E 31.73' N.W. cor. of house fdn. S 60° W 124.57' N.E. cor. porch S 38° W 99.65'

And is accepted as a careful and faithful reestablishment of the position of the original corner.

Signed by Frederick J. Cutcher Date December 22, 1993 Surveyor's Michigan License No. 24592